


Make: Holden	Model: Commodore	Body Style: Sedan
Year: 2019	Registration: LWM35	Reg Expiry: 17 Jan 2025
WoF Expiry: 18 Mar 2025	Odometer: 199,881 Kms	Good No: 19382415
VIN: W0VZM6EC6K102738	Next Service: 203,000kms	Service History: No

Note: This report is not a warranty

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

Key:

- S = scratch
- D = dent
- R = rust
- PT = paint defect
- C = crack
- P = pin dent
- * = decals
- SC = stone chips
- W = significant scuffs

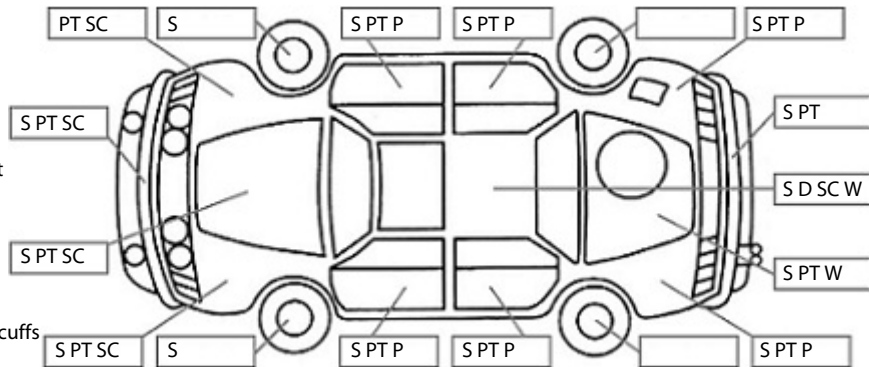

Body Inspection Comments

Note: some defects & blemishes may not be displayed in the diagram

Right front headlight is not working on low beam. Holes in both corners of front bumper & both corners of rear bumper. Three holes in roof panel, have been sealed up. Spare tyre is flat. Water inside left rear taillight. Mirror in right side wing mirror has three large crack through it.

Conditions During Body Inspection: Wet

Under Carriage & Under Bonnet Inspection Comments

Right side outer cv boot is starting to split. Three holes in left front floor area, have been sealed up.

Interior Comments

Seats	Poor
Carpets	Average
Panels	Average
Dashboard	Average

General Comments

Hole in fabric on back rest of drivers seat, has been tapped up. Screw holes in dashboard, left side of centre console & top of centre console. Glovebox is falling open to far, glovebox stopper clip is no catching correctly. Boot floor panel is not the correct factory & doesn't fit correctly.

Road Conditions During Test Drive: Wet

Engine Timing Mechanism: Timing Chain
 Evidence of Cam Belt Replacement: Not Applicable Kms:

	Pass	Fail	N/A
Engine			
Oil level	✓		
Smoke & fumes	✓		
Performance	✓		
Noise	✓		
Cooling System			
Coolant condition	✓		
Performance	✓		
Radiator / Hoses (visual)	✓		
Transmission			
Operation	✓		
Noise	✓		
Clutch			✓
CV joints	✓		
Wheel bearings	✓		
Brakes			
Performance	✓		
Hand Brake	✓		
Tyres (lowest observed tread depth of tyres)			
Left front	2.5	mm	
Right front	3.4	mm	
Left rear	4.2	mm	
Right rear	5.5	mm	
Spare	Yes		
Suspension			
Suspension performance	✓		
Steering performance	✓		
Shock absorbers	✓		
Air Conditioning / Heater			
Operation	✓		
Electrical / Accessories			
Head lights		✓	
Tail lights		✓	
Indicators	✓		
Dashboard warning lights	✓		
Wipers (front & rear)	✓		
Window winder FL	✓		
Window winder FR	✓		
Window winder RL	✓		
Window winder RR	✓		
Rear view mirrors	✓		
Radio (basic test only)	✓		
CD (basic test only)			✓
Number of keys	3		
Central locking	✓		
Remote locking	✓		
Sat. Nav. (basic test only)			✓
Reversing camera	✓		

Inspected by: Jason Young

Date: 10 Sep 2024

I have read and understood this condition guide. Name: Signature: