


<b>Make:</b> Nissan	<b>Model:</b> Navara	<b>Body Style:</b> Utility
<b>Year:</b> 2012	<b>Registration:</b> GQP828	<b>Reg Expiry:</b> 02 Aug 2024
<b>WoF Expiry:</b> 22 Mar 2025	<b>Odometer:</b> 201,298 Kms	<b>Good No:</b> 19383262
<b>VIN:</b> VSKCVAD40A0456013	<b>Next Service:</b> 203,000kms	<b>Service History:</b> No

**Note: This report is not a warranty**

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

**Key:**

- S = scratch
- D = dent
- R = rust
- PT = paint defect
- C = crack
- P = pin dent
- \* = decals
- SC = stone chips
- W = significant scuffs

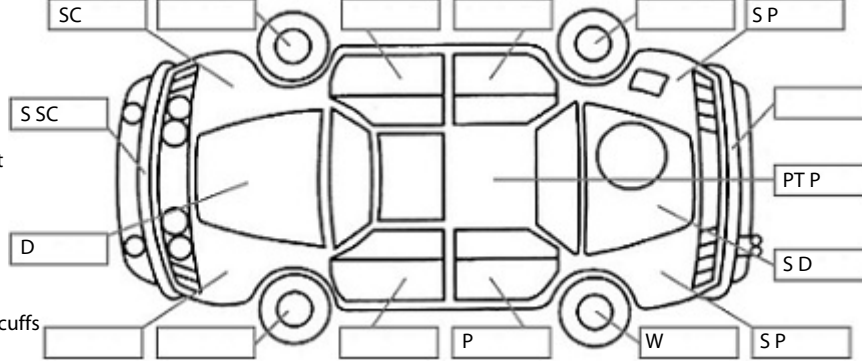

**Body Inspection Comments**

Note: some defects & blemishes may not be displayed in the diagram

Water in left headlight. Stone cracks on windscreen, 1 in black area.  
Paint shrink and crack on roof panel.  
Left front mudflap tone, bent. Right front guard inner trim is broken.  
Left front door outer door handle key cylinder cover is missing.

Conditions During Body Inspection: Dry

**Under Carriage & Under Bonnet Inspection Comments**

Bow-by leaking. Weeping from oil cooling line.  
Surface rust is developing on steel rim for spare tyre.

**Interior Comments**

Seats	Good
Carpets	Good
Panels	Good
Dashboard	Average

**General Comments**

Power steering pump belt is squeaking when turning sharp.  
No power for radio head unit.  
Canopy key is missing. Jack and tools are missing.

Road Conditions During Test Drive: Dry

Engine Timing Mechanism: Timing Chain  
Evidence of Cam Belt Replacement: Not Applicable Kms:

	Pass	Fail	N/A
<b>Engine</b>			
Oil level	✓		
Smoke & fumes	✓		
Performance	✓		
Noise	✓		
<b>Cooling System</b>			
Coolant condition	✓		
Performance	✓		
Radiator / Hoses (visual)	✓		
<b>Transmission</b>			
Operation	✓		
Noise	✓		
Clutch	✓		
CV joints	✓		
Wheel bearings	✓		
<b>Brakes</b>			
Performance	✓		
Hand Brake	✓		
<b>Tyres</b> (lowest observed tread depth of tyres)			
Left front	4.0	mm	
Right front	5.0	mm	
Left rear	4.0	mm	
Right rear	4.0	mm	
Spare	Yes		
<b>Suspension</b>			
Suspension performance	✓		
Steering performance	✓		
Shock absorbers	✓		
<b>Air Conditioning / Heater</b>			
Operation	✓		
<b>Electrical / Accessories</b>			
Head lights	✓		
Tail lights	✓		
Indicators	✓		
Dashboard warning lights	✓		
Wipers (front & rear)	✓		
Window winder FL	✓		
Window winder FR	✓		
Window winder RL	✓		
Window winder RR	✓		
Rear view mirrors	✓		
Radio (basic test only)		✓	
CD (basic test only)			✓
Number of keys	1		
Central locking	✓		
Remote locking	✓		
Sat. Nav. (basic test only)			✓
Reversing camera			✓

Inspected by: Yuki Itohara

Date: 05 Aug 2024

I have read and understood this condition guide. Name: ..... Signature: .....