


<b>Make:</b> LDV	<b>Model:</b> G10	<b>Body Style:</b> Van
<b>Year:</b> 2017	<b>Registration:</b> KHU54	<b>Reg Expiry:</b> 08 Aug 2024
<b>WoF Expiry:</b> 09 Nov 2024	<b>Odometer:</b> 200,650 Kms	<b>Good No:</b> 22980807
<b>VIN:</b> LSKG4GL14GA425137	<b>Next Service:</b> 200000	<b>Service History:</b> No

**Note: This report is not a warranty**

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

**Key:**  
 S = scratch  
 D = dent  
 R = rust  
 PT = paint defect  
 C = crack  
 P = pin dent  
 \* = decals  
 SC = stone chips  
 W = significant scuffs

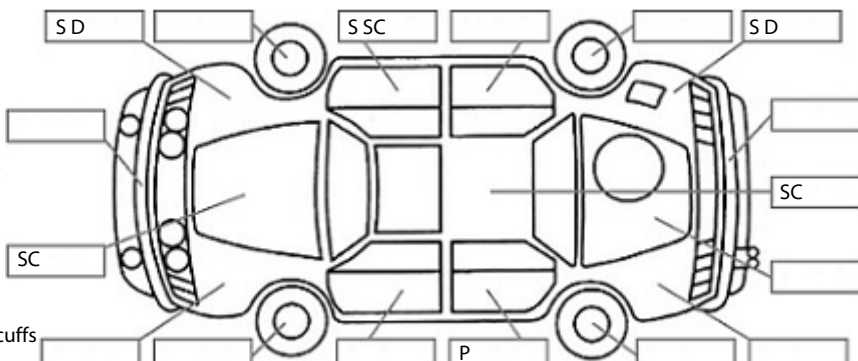

**Body Inspection Comments** Note: some defects & blemishes may not be displayed in the diagram

Right hand drivers side sill paint worn off, minor stonechips front windscreen, clear coat coming of both headlights, surface rust on both front door lower panels, x3 rear floor interior tether hooks have surface rust, surface rust along top of windscreen, lower front bumper grille loose,

Conditions During Body Inspection: Dry

**Under Carriage & Under Bonnet Inspection Comments**  
 Surface rust appearing on under carriage and spare wheel rim,

**Interior Comments**

Seats	wear and tear
Carpets	dirty
Panels	rust on teather hooks
Dashboard	Good

**General Comments**  
 Couldnt find tools for flat tyres, on further inspection there is surface rust appearing around the front windscreen rubbers/mouldings

Road Conditions During Test Drive: Dry

Engine Timing Mechanism: Timing Chain  
 Evidence of Cam Belt Replacement: Not Applicable Kms:

	Pass	Fail	N/A
<b>Engine</b>			
Oil level	✓		
Smoke & fumes	✓		
Performance	✓		
Noise	✓		
<b>Cooling System</b>			
Coolant condition	✓		
Performance	✓		
Radiator / Hoses (visual)	✓		
<b>Transmission</b>			
Operation	✓		
Noise	✓		
Clutch	✓		
CV joints	✓		
Wheel bearings	✓		
<b>Brakes</b>			
Performance	✓		
Hand Brake	✓		
<b>Tyres</b> (lowest observed tread depth of tyres)			
Left front	6.5	mm	
Right front	6.2	mm	
Left rear	5.5	mm	
Right rear	5.5	mm	
Spare	Yes		
<b>Suspension</b>			
Suspension performance	✓		
Steering performance	✓		
Shock absorbers	✓		
<b>Air Conditioning / Heater</b>			
Operation	✓		
<b>Electrical / Accessories</b>			
Head lights	✓		
Tail lights	✓		
Indicators	✓		
Dashboard warning lights	✓		
Wipers (front & rear)	✓		
Window winder FL	✓		
Window winder FR	✓		
Window winder RL			✓
Window winder RR			✓
Rear view mirrors	✓		
Radio (basic test only)	✓		
CD (basic test only)	✓		
Number of keys	2		
Central locking	✓		
Remote locking	✓		
Sat. Nav. (basic test only)			✓
Reversing camera	✓		

Inspected by: Jesse Roberts Date: 29 May 2024

I have read and understood this condition guide. Name: ..... Signature: .....