

Basic Vehicle Condition Guide

Report ID: 23,033,824

Version: 1

Engine

Created: 02 Jul 2024


N/A

Fail

Make: Model: Ford Ranger **Body Style:** Utility Year: 2009 Registration: FAF901 **Reg Expiry:** 22 Jun 2025 WoF Expiry: **Odometer:** 04 Sep 2024 339,178 Kms **Good No:** 23033824 VIN: MNALS2E908W78108 **Next Service:** overdue Service History: Yes

Note: This report is not a warranty

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

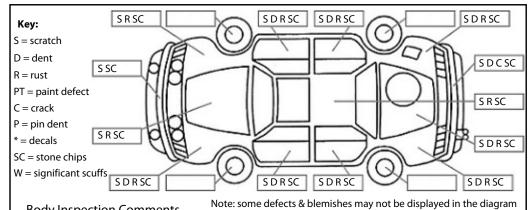

Body Inspection Comments

Requires canopy door struts. Headlights are faded. Large bullseye with cracks in centre of front screen

Conditions During Body Inspection: Dry

Under Carriage & Under Bonnet Inspection Comments

Significant oil leaks vehicle has belly pans. Surface rust on chassis. Oil level approximately 1/2. Radiator was very low and coolant bottle empty and potential leak from radiator recommend further investigation. Brake fluid low

Interior Comments

Seats	marks
Carpets	hole drivers foot well
Panels	scuffs scratches marks
Dashboard	scratches

General Comments

Inspected by:

Requires drivers seatbelt. Steering wheel off centre and vehicle pulls to curb. Clutch has a low bite point but functional. Lhf upper park light nw. Air conditioning works but heaters not very warm. Under dashboard drivers section missing

Road Conditions During Test Drive: Dry

Engine Timing Mechanism: Cambelt

Gary Adams

Evidence of Cam Belt Replacement: Kms: No

Oil level			
Smoke & fumes	~		
Performance	~		
Noise	~		
Cooling System		•	
Coolant condition		~	
Performance	~		
Radiator / Hoses (visual)		~	
Transmission	•	!	•
Operation	~		
Noise	VVV		
Clutch	~		
CV joints	~		
Wheel bearings	~		
Brakes			1
Performance		~	
Hand Brake	~		
Tyres (lowest observed treac	depth	of tyr	es)
Left front	3.0 mm		
Right front	3.0		mm
Left rear	3.0		mm
Right rear	4.0		mm
Spare		Yes	
Suspension			
Suspension performance	~		
Steering performance		~	
Shock absorbers	~		
Air Conditioning / Heater			1
Operation	~		
Electrical / Accessories			
Head lights		~	
Tail lights	~		
Indicators	~		
Dashboard warning lights	~		
Wipers (front & rear)	~		
Window winder FL	V V V V V		
Window winder FR	~		
Window winder RL	~		
Window winder RR	~		
Rear view mirrors	~		
Radio (basic test only)	~		
CD (basic test only)	~		
Number of keys	1	l .	1
Central locking	~		
Remote locking			~
Sat. Nav. (basic test only)			~
Poversing camera			.,

I have read and understood this condition guide.

Name:

Signature:

02 Jul 2024

Date: