


<b>Make:</b>	Mitsubishi	<b>Model:</b>	Triton	<b>Body Style:</b>	Utility
<b>Year:</b>	2017	<b>Registration:</b>	KPA209	<b>Reg Expiry:</b>	15 Aug 2024
<b>WoF Expiry:</b>	08 Jun 2025	<b>Odometer:</b>	98,550 Kms	<b>Good No:</b>	24952557
<b>VIN:</b>	MMAYYKK10HH00753	<b>Next Service:</b>	112,000kms	<b>Service History:</b>	Yes

## Note: This report is not a warranty

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

## Key:

S = scratch  
D = dent  
R = rust  
PT = paint defect  
C = crack  
P = pin dent  
\* = decals  
SC = stone chips  
W = significant scuffs

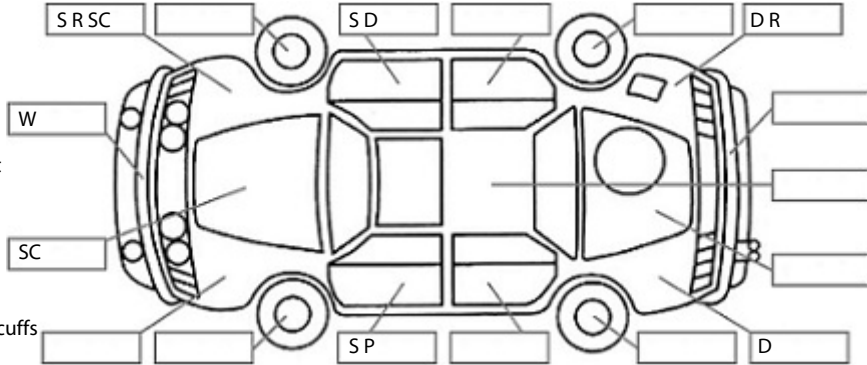

## Body Inspection Comments

Note: some defects & blemishes may not be displayed in the diagram

Minor stone cracks out of C.V.A.  
Dent and surface rust on right A-pillar. Both side sill paint worn.  
Rust and scrape scratch, paint flaking on Deck steel cabinets.  
1 of lock (deck steel cabinets) is not operating.

Conditions During Body Inspection: Dry

## Under Carriage & Under Bonnet Inspection Comments

## Interior Comments

Seats	Average
Carpets	Average
Panels	Average
Dashboard	Average

## General Comments

Driver's seat base trim is worn, torn.

Road Conditions During Test Drive: Wet

Engine Timing Mechanism: Timing Chain

Evidence of Cam Belt Replacement: Not Applicable Kms:

	Pass	Fail	N/A
<b>Engine</b>			
Oil level	✓		
Smoke & fumes	✓		
Performance	✓		
Noise	✓		
<b>Cooling System</b>			
Coolant condition	✓		
Performance	✓		
Radiator / Hoses (visual)	✓		
<b>Transmission</b>			
Operation	✓		
Noise	✓		
Clutch			✓
CV joints	✓		
Wheel bearings	✓		
<b>Brakes</b>			
Performance	✓		
Hand Brake	✓		
<b>Tyres</b> (lowest observed tread depth of tyres)			
Left front	9	mm	
Right front	9	mm	
Left rear	9	mm	
Right rear	9	mm	
Spare	Yes		
<b>Suspension</b>			
Suspension performance	✓		
Steering performance	✓		
Shock absorbers	✓		
<b>Air Conditioning / Heater</b>			
Operation	✓		
<b>Electrical / Accessories</b>			
Head lights	✓		
Tail lights	✓		
Indicators	✓		
Dashboard warning lights	✓		
Wipers (front & rear)	✓		
Window winder FL	✓		
Window winder FR	✓		
Window winder RL			✓
Window winder RR			✓
Rear view mirrors	✓		
Radio (basic test only)	✓		
CD (basic test only)	✓		
Number of keys	2		
Central locking	✓		
Remote locking	✓		
Sat. Nav. (basic test only)			✓
Reversing camera	✓		

Inspected by: Yuki Itoharu

Date: 01 Jul 2024

I have read and understood this condition guide.

Name: .....

Signature: .....