


<b>Make:</b> Holden	<b>Model:</b> Colorado	<b>Body Style:</b> Utility
<b>Year:</b> 2013	<b>Registration:</b> GWU664	<b>Reg Expiry:</b> 09 Jun 2025
<b>WoF Expiry:</b> 04 Jul 2025	<b>Odometer:</b> 157,520 Kms	<b>Good No:</b> 24953886
<b>VIN:</b> MMU148CH0DH6814	<b>Next Service:</b> 163,736kms	<b>Service History:</b> Yes

**Note: This report is not a warranty**

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

**Key:**  
 S = scratch  
 D = dent  
 R = rust  
 PT = paint defect  
 C = crack  
 P = pin dent  
 \* = decals  
 SC = stone chips  
 W = significant scuffs

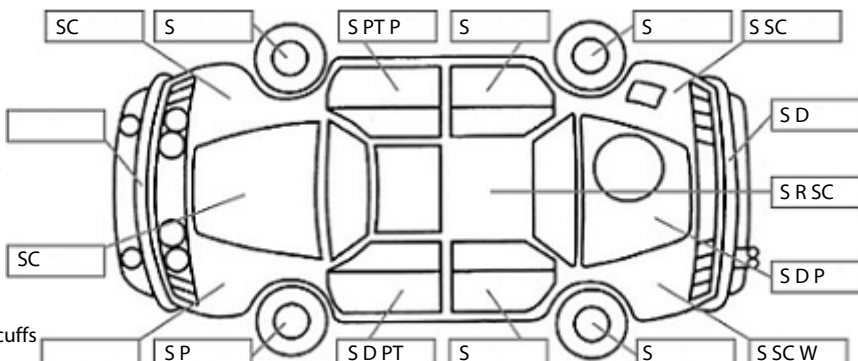

**Body Inspection Comments** Note: some defects & blemishes may not be displayed in the diagram

Right rear brake & high stop taillight are not working. Paint clear coat is peeling off canopy roof, both right & left side wing mirror covers. Outside edge on right front tyre is worn very low, tyre will need replacing very soon.

Conditions During Body Inspection: **Wet**

**Under Carriage & Under Bonnet Inspection Comments**  
 Radiator/coolant system needs a flush & is low on coolant. Underbody surface rust.

**Interior Comments**

Seats	Average
Carpets	Good
Panels	Good
Dashboard	Good

**General Comments**  
 Engine smokey, Engine check light is staying on. Hole in fabric on base pad of driver's seat. Cd player is not loading cd's into unit. Has a aftermarket jack in vehicle & wheel brace is missing. Vehicle has a flat battery.

Road Conditions During Test Drive: **Wet**

Engine Timing Mechanism: **Cambelt**  
 Evidence of Cam Belt Replacement: **No** Kms:

	Pass	Fail	N/A
<b>Engine</b>			
Oil level	✓		
Smoke & fumes		✓	
Performance	✓		
Noise	✓		
<b>Cooling System</b>			
Coolant condition		✓	
Performance	✓		
Radiator / Hoses (visual)	✓		
<b>Transmission</b>			
Operation	✓		
Noise	✓		
Clutch	✓		
CV joints			✓
Wheel bearings	✓		
<b>Brakes</b>			
Performance	✓		
Hand Brake	✓		
<b>Tyres</b> (lowest observed tread depth of tyres)			
Left front	5.2	mm	
Right front	2.0	mm	
Left rear	6.0	mm	
Right rear	6.0	mm	
Spare	Yes		
<b>Suspension</b>			
Suspension performance	✓		
Steering performance	✓		
Shock absorbers	✓		
<b>Air Conditioning / Heater</b>			
Operation	✓		
<b>Electrical / Accessories</b>			
Head lights	✓		
Tail lights		✓	
Indicators	✓		
Dashboard warning lights		✓	
Wipers (front & rear)	✓		
Window winder FL	✓		
Window winder FR	✓		
Window winder RL	✓		
Window winder RR	✓		
Rear view mirrors	✓		
Radio (basic test only)	✓		
CD (basic test only)		✓	
Number of keys	1		
Central locking	✓		
Remote locking	✓		
Sat. Nav. (basic test only)			✓
Reversing camera			✓

Inspected by: **Jason Young** Date: **27 Nov 2024**

I have read and understood this condition guide. Name: ..... Signature: .....