


<b>Make:</b> Lexus	<b>Model:</b> IS250	<b>Body Style:</b> Sedan
<b>Year:</b> 2007	<b>Registration:</b> LWJ45	<b>Reg Expiry:</b> 09 Mar 2025
<b>WoF Expiry:</b> 19 Jan 2025	<b>Odometer:</b> 208,160 Kms	<b>Good No:</b> 25007466
<b>VIN:</b> 7AT0B00EX18048723	<b>Next Service:</b> no service history	<b>Service History:</b> No

**Note: This report is not a warranty**

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

**Key:**

- S = scratch
- D = dent
- R = rust
- PT = paint defect
- C = crack
- P = pin dent
- \* = decals
- SC = stone chips
- W = significant scuffs

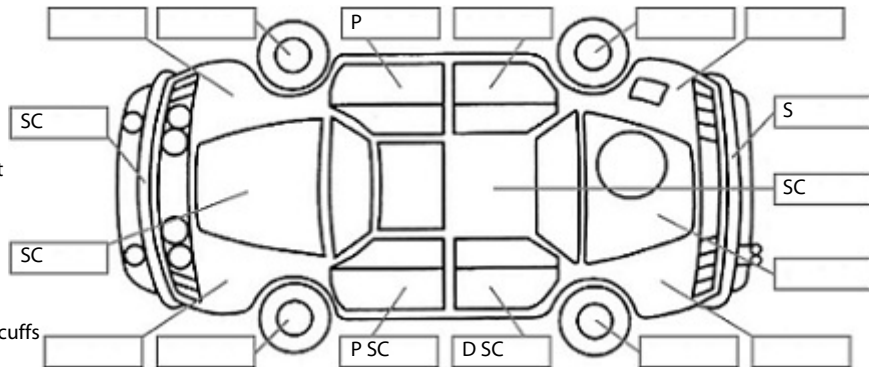

**Body Inspection Comments**

Note: some defects & blemishes may not be displayed in the diagram

Rear wheel arches have been damaged by the tyres hitting them. Stone chips rusty

Conditions During Body Inspection: Wet

**Under Carriage & Under Bonnet Inspection Comments**

Vehicle lowered. Tyres stretched. Oil leak at transmission bell housing (rear main seal possibly). Air filter housing modified poorly has duct tape and holes cut ect. Pod filter fitted. Battery passed test at time of inspection

**Interior Comments**

Seats	Average
Carpets	Average
Panels	Poor
Dashboard	Poor

**General Comments**

A/c and reverse camera working at time of inspection. Nav has no maps loaded. Interior rough has animal scratches everywhere. No tools. No jack. No spline nut socket (the wheel nuts/studs are spline type)

Road Conditions During Test Drive: Dry

Engine Timing Mechanism: Timing Chain  
 Evidence of Cam Belt Replacement: Not Applicable Kms:

	Pass	Fail	N/A
<b>Engine</b>			
Oil level	✓		
Smoke & fumes	✓		
Performance	✓		
Noise	✓		
<b>Cooling System</b>			
Coolant condition	✓		
Performance	✓		
Radiator / Hoses (visual)	✓		
<b>Transmission</b>			
Operation	✓		
Noise	✓		
Clutch			✓
CV joints			✓
Wheel bearings	✓		
<b>Brakes</b>			
Performance	✓		
Hand Brake	✓		
<b>Tyres</b> (lowest observed tread depth of tyres)			
Left front	6.0	mm	
Right front	6.0	mm	
Left rear	5.5	mm	
Right rear	5.5	mm	
Spare	Yes		
<b>Suspension</b>			
Suspension performance	✓		
Steering performance	✓		
Shock absorbers	✓		
<b>Air Conditioning / Heater</b>			
Operation	✓		
<b>Electrical / Accessories</b>			
Head lights	✓		
Tail lights	✓		
Indicators	✓		
Dashboard warning lights	✓		
Wipers (front & rear)	✓		
Window winder FL	✓		
Window winder FR	✓		
Window winder RL	✓		
Window winder RR	✓		
Rear view mirrors	✓		
Radio (basic test only)	✓		
CD (basic test only)	✓		
Number of keys	1		
Central locking	✓		
Remote locking	✓		
Sat. Nav. (basic test only)		✓	
Reversing camera	✓		

Inspected by: Reuben Harvey

Date: 12 Dec 2024

I have read and understood this condition guide. Name: ..... Signature: .....