

# **Basic Vehicle Condition Guide**

Report ID: 25,007,654


Version: 4

Created: 10 Jan 2025

Make: Model: Mitsubishi Triton **Body Style:** Utility Year: 2019 Registration: **MJJ846 Reg Expiry:** 29 Aug 2025 WoF Expiry: **Odometer:** 23 Aug 2025 170,940 Kms **Good No:** 25007654 VIN: MMAJLKL10LH00036: Next Service: 180,000kms Service History: Yes

#### Note: This report is not a warranty

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

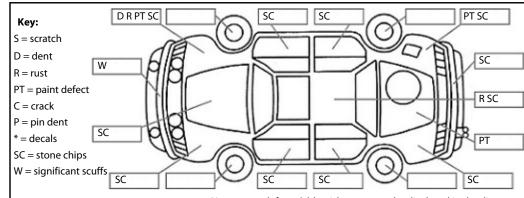

# **Body Inspection Comments**

Note: some defects & blemishes may not be displayed in the diagram

Rusty stone chips in rear wheel arches. Rh fog light lenses cracked. Front grill poor repair. Paint repairs to tail gate has contamination. Vehicle has paint touch ups. Rusty stone chips

Conditions During Body Inspection: Dry

## **Under Carriage & Under Bonnet Inspection Comments**

Oil dirty. Battery clamp poor fit. Battery incorrect type for vehicle.

<u>Interior Comments</u>			
Seats	Good		
Carpets	Good		
Panels	Good		
Dashboard	Good		

### **General Comments**

Charging system service required prompt on dash. No keys for canopy needs prm10 type key. Vehicle struggling to hold idle. Large thumping from rear of vehicle during test drive further inspection recommended. A/c and reverse camera good at time of inspection. Hole in switch cluster rh steering wheel. Odours in vehicle. Engine light on

Road Conditions During Test Drive: Dry

Engine Timing Mechanism: Timing Chain

Evidence of Cam Belt Replacement: Not Applicable Kms:

Inspected by: Reuben Harvey Date: 27 Dec 2024

	Pass	Fail	N/A		
Engine					
Oil level	~				
Smoke & fumes	\( \triangle \)				
Performance	~				
Noise	~				
Cooling System					
Coolant condition	~				
Performance	\( \times \)				
Radiator / Hoses (visual)	~				
Transmission					
Operation	~				
Noise	~				
Clutch			~		
CV joints	>				
Wheel bearings	~				
Brakes					
Performance	~				
Hand Brake	~				
Tyres (lowest observed tread	depth	of tyre	es)		
Left front	5	.5	mm		
Right front	6	.5	mm		
Left rear	5	.5	mm		
Right rear	5	.0	mm		
Spare		Yes			
Suspension					
Suspension performance	>				
Steering performance	V				
Shock absorbers	>				
Air Conditioning / Heater					
Operation	>				
Electrical / Accessories					
Head lights	~				
Tail lights	~				
Indicators	~				
Dashboard warning lights	~				
Wipers (front & rear)	\( \times \)				
Window winder FL	~				
Window winder FR	\( \triangle \)				
Window winder RL	~				
Window winder RR	~				
Rear view mirrors	~				
Radio (basic test only)	~				
CD (basic test only)			~		
Number of keys	1				
Central locking	~				
Remote locking	~				
Sat. Nav. (basic test only)	~				
Reversing camera	~				
			•		

I have read and understood this condition guide.

Name: .....

Signature: .....