


<b>Make:</b> LDV	<b>Model:</b> G10	<b>Body Style:</b> Van
<b>Year:</b> 2017	<b>Registration:</b> KJF509	<b>Reg Expiry:</b> 02 Dec 2024
<b>WoF Expiry:</b> 11 Apr 2025	<b>Odometer:</b> 255,183 Kms	<b>Good No:</b> 25053230
<b>VIN:</b> LSKG4GL13GA427252	<b>Next Service:</b> unknown	<b>Service History:</b> No

**Note: This report is not a warranty**

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

- Key:**  
S = scratch  
D = dent  
R = rust  
PT = paint defect  
C = crack  
P = pin dent  
\* = decals  
SC = stone chips  
W = significant scuffs

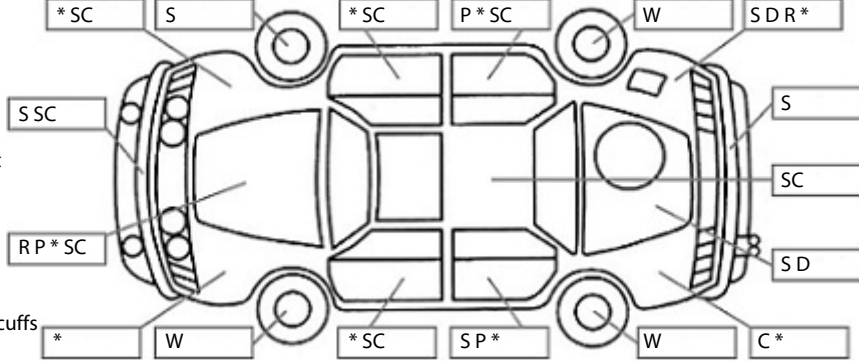

**Body Inspection Comments**

Note: some defects & blemishes may not be displayed in the diagram

Left wing mirror indicator damaged. Rear wiper removed. L/H sill pin dent  
Poor repair on left quarter panel. 2 wheel centre caps missing.  
Rust on bonnet, rusty chips on roof. Detachable tow bar, tongue missing.  
Front bumper needs fitting properly on left. Chipped windscreen.

Conditions During Body Inspection: Wet

**Under Carriage & Under Bonnet Inspection Comments**

Engine oil leak.  
Surface rust under carriage.

**Interior Comments**

Seats	Average
Carpets	Average
Panels	Scratches, scuffs & hatch door panel missing.
Dashboard	Average

**General Comments**

6 speed manual diesel LDV van.  
Service vehicle light on.

Road Conditions During Test Drive: Dry

Engine Timing Mechanism: Timing Chain  
Evidence of Cam Belt Replacement: Not Applicable Kms:

	Pass	Fail	N/A
<b>Engine</b>			
Oil level	✓		
Smoke & fumes	✓		
Performance	✓		
Noise	✓		
<b>Cooling System</b>			
Coolant condition	✓		
Performance	✓		
Radiator / Hoses (visual)	✓		
<b>Transmission</b>			
Operation	✓		
Noise	✓		
Clutch	✓		
CV joints			✓
Wheel bearings	✓		
<b>Brakes</b>			
Performance	✓		
Hand Brake	✓		
<b>Tyres</b> (lowest observed tread depth of tyres)			
Left front	5	mm	
Right front	6	mm	
Left rear	5	mm	
Right rear	5	mm	
Spare		Yes	
<b>Suspension</b>			
Suspension performance	✓		
Steering performance	✓		
Shock absorbers	✓		
<b>Air Conditioning / Heater</b>			
Operation	✓		
<b>Electrical / Accessories</b>			
Head lights	✓		
Tail lights	✓		
Indicators	✓		
Dashboard warning lights	✓		
Wipers (front & rear)	✓		
Window winder FL	✓		
Window winder FR	✓		
Window winder RL			✓
Window winder RR			✓
Rear view mirrors	✓		
Radio (basic test only)	✓		
CD (basic test only)	✓		
Number of keys	1		
Central locking	✓		
Remote locking	✓		
Sat. Nav. (basic test only)			✓
Reversing camera	✓		

Inspected by: Daryll Timms

Date: 22 Aug 2024

I have read and understood this condition guide. Name: ..... Signature: .....