


| | | |
|--------------------------------|-------------------------------|--------------------------------|
| Make: Toyota | Model: Hilux | Body Style: Utility |
| Year: 2019 | Registration: MPS925 | Reg Expiry: 16 Dec 2024 |
| WoF Expiry: 30 Nov 2024 | Odometer: 87,950 Kms | Good No: 25086709 |
| VIN: MR0KA3CD00123802 | Next Service: 90,000km | Service History: Yes |

Note: This report is not a warranty

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

Key:

- S = scratch
- D = dent
- R = rust
- PT = paint defect
- C = crack
- P = pin dent
- * = decals
- SC = stone chips
- W = significant scuffs

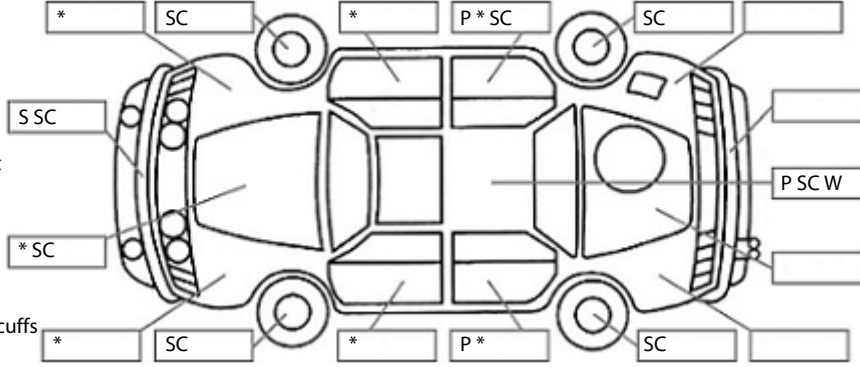

Note: some defects & blemishes may not be displayed in the diagram

Body Inspection Comments

Stone chip in windscreen.
Right sill panel is worn.
Drivers door seal is torn.

Conditions During Body Inspection: Dry

Under Carriage & Under Bonnet Inspection Comments

Undercarriage dirty.
Aftermarket shock absorbers fitted.

Interior Comments

| | |
|-----------|---|
| Seats | Average |
| Carpets | Average |
| Panels | Average |
| Dashboard | Average, screw holes in dash & console. |

General Comments

Vibration in driveline.

Road Conditions During Test Drive: Dry

Engine Timing Mechanism: Timing Chain
Evidence of Cam Belt Replacement: Not Applicable Kms:

| | Pass | Fail | N/A |
|---|------|------|-----|
| Engine | | | |
| Oil level | ✓ | | |
| Smoke & fumes | ✓ | | |
| Performance | ✓ | | |
| Noise | ✓ | | |
| Cooling System | | | |
| Coolant condition | ✓ | | |
| Performance | ✓ | | |
| Radiator / Hoses (visual) | ✓ | | |
| Transmission | | | |
| Operation | ✓ | | |
| Noise | ✓ | | |
| Clutch | | | ✓ |
| CV joints | ✓ | | |
| Wheel bearings | ✓ | | |
| Brakes | | | |
| Performance | ✓ | | |
| Hand Brake | ✓ | | |
| Tyres (lowest observed tread depth of tyres) | | | |
| Left front | 3 | mm | |
| Right front | 3.5 | mm | |
| Left rear | 1.5 | mm | |
| Right rear | 4 | mm | |
| Spare | Yes | | |
| Suspension | | | |
| Suspension performance | ✓ | | |
| Steering performance | ✓ | | |
| Shock absorbers | ✓ | | |
| Air Conditioning / Heater | | | |
| Operation | ✓ | | |
| Electrical / Accessories | | | |
| Head lights | ✓ | | |
| Tail lights | ✓ | | |
| Indicators | ✓ | | |
| Dashboard warning lights | ✓ | | |
| Wipers (front & rear) | ✓ | | |
| Window winder FL | ✓ | | |
| Window winder FR | ✓ | | |
| Window winder RL | ✓ | | |
| Window winder RR | ✓ | | |
| Rear view mirrors | ✓ | | |
| Radio (basic test only) | ✓ | | |
| CD (basic test only) | ✓ | | |
| Number of keys | 3 | | |
| Central locking | ✓ | | |
| Remote locking | ✓ | | |
| Sat. Nav. (basic test only) | | | ✓ |
| Reversing camera | ✓ | | |

Inspected by: Blair Robertson

Date: 26 Sep 2024

I have read and understood this condition guide. Name: Signature: