


Make: Toyota	Model: Hiace 2.4ZR MAN	Body Style: Van
Year: 1993	Registration: RU4743	Reg Expiry: 01 Jan 2025
WoF Expiry: 08 Aug 2024	Odometer: 243,265 Kms	Good No: 25756977
VIN:	Next Service: 252,000kms	Service History: No

Note: This report is not a warranty

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

Key:

- S = scratch
- D = dent
- R = rust
- PT = paint defect
- C = crack
- P = pin dent
- * = decals
- SC = stone chips
- W = significant scuffs

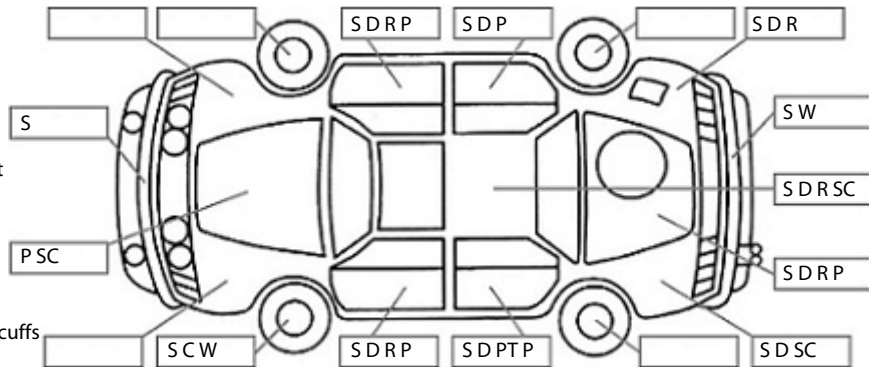

Body Inspection Comments

Note: some defects & blemishes may not be displayed in the diagram

Plastic cover missing off left front wiper arm. Rust starting on bottom inside edge of left front door. Rust starting on right rear C pillar, on inside of tailgate door frame. Radio aerial is bent. Rust starting to bubble up under paint, at bottom of right front door. Missing left rear wheel hub cap

Conditions During Body Inspection: Wet

Under Carriage & Under Bonnet Inspection Comments

Oil leaking around engine rocker cover & running down front & right side of engine block, very wet with oil around bottom of engine sump pan & around engine/gearbox area, as keeping with age & km's. Underbody surface rust. Outside edge worn on left front tyre.

Interior Comments

Seats	Average
Carpets	Average
Panels	Good
Dashboard	Good

General Comments

Hole in fabric on base of drivers seat & foam worn down to frame. Carpet worn in right front. Right front interior door handle surround is missing. Switch blank missing out of right side of dashboard. Left sliding door will not lock or unlock with central locking. Drivers seat belt webbing is worn.

Road Conditions During Test Drive: Wet

Engine Timing Mechanism: Timing Chain
 Evidence of Cam Belt Replacement: Not Applicable Kms:

	Pass	Fail	N/A
Engine			
Oil level	✓		
Smoke & fumes	✓		
Performance	✓		
Noise	✓		
Cooling System			
Coolant condition	✓		
Performance	✓		
Radiator / Hoses (visual)	✓		
Transmission			
Operation	✓		
Noise	✓		
Clutch	✓		
CV joints			✓
Wheel bearings	✓		
Brakes			
Performance	✓		
Hand Brake	✓		
Tyres (lowest observed tread depth of tyres)			
Left front	3.4	mm	
Right front	4.0	mm	
Left rear	3.8	mm	
Right rear	4.0	mm	
Spare	N/A		
Suspension			
Suspension performance	✓		
Steering performance	✓		
Shock absorbers	✓		
Air Conditioning / Heater			
Operation			✓
Electrical / Accessories			
Head lights	✓		
Tail lights	✓		
Indicators	✓		
Dashboard warning lights	✓		
Wipers (front & rear)	✓		
Window winder FL	✓		
Window winder FR	✓		
Window winder RL			✓
Window winder RR			✓
Rear view mirrors	✓		
Radio (basic test only)	✓		
CD (basic test only)	✓		
Number of keys	2		
Central locking		✓	
Remote locking			✓
Sat. Nav. (basic test only)			✓
Reversing camera			✓

Inspected by: Jason Young

Date: 16 May 2024

I have read and understood this condition guide. Name: Signature: