


<b>Make:</b> Ssangyong	<b>Model:</b> Actyon Sport	<b>Body Style:</b> Utility
<b>Year:</b> 2017	<b>Registration:</b> KNF155	<b>Reg Expiry:</b> 26 Jul 2024
<b>WoF Expiry:</b> 03 Apr 2025	<b>Odometer:</b> 242,254 Kms	<b>Good No:</b> 25770247
<b>VIN:</b> KPADA1ETSGP289688	<b>Next Service:</b> 251,000kms	<b>Service History:</b> No

**Note: This report is not a warranty**

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

**Key:**

- S = scratch
- D = dent
- R = rust
- PT = paint defect
- C = crack
- P = pin dent
- \* = decals
- SC = stone chips
- W = significant scuffs

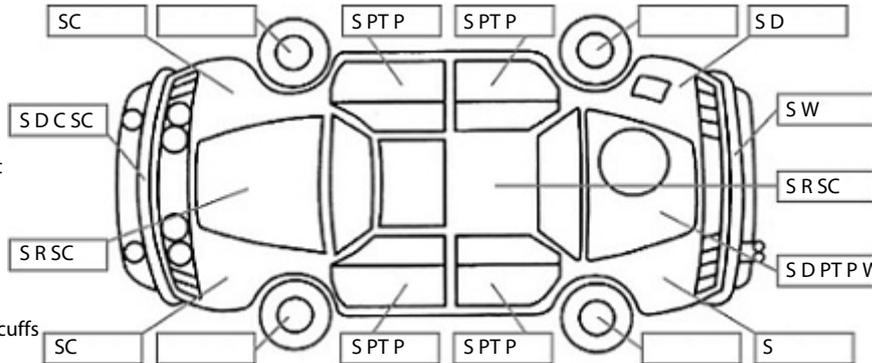

**Body Inspection Comments**

Note: some defects & blemishes may not be displayed in the diagram

Small stone crack in middle of windscreen. Bottom of front grille is cracked. Spot light blanking panels are missing out of left & right sides of front bumper. Rust developing along top edge of windscreen.

Conditions During Body Inspection: Dry

**Under Carriage & Under Bonnet Inspection Comments**

Lower front grille has broken clips on left side & is not fitting correctly.

**Interior Comments**

Seats	Average
Carpets	Average
Panels	Average
Dashboard	Good

**General Comments**

Large hole in fabric in base of drivers seat. Small cut in fabric on middle of rear seat back rest. Two holes in carpet in right front foot well area. Keys for locks on rear canopy door are missing. Some of the tools for using vehicle jack are missing.

Road Conditions During Test Drive: Dry

Engine Timing Mechanism: Timing Chain  
 Evidence of Cam Belt Replacement: Not Applicable Kms:

	Pass	Fail	N/A
<b>Engine</b>			
Oil level	✓		
Smoke & fumes	✓		
Performance	✓		
Noise	✓		
<b>Cooling System</b>			
Coolant condition	✓		
Performance	✓		
Radiator / Hoses (visual)	✓		
<b>Transmission</b>			
Operation	✓		
Noise	✓		
Clutch	✓		
CV joints			✓
Wheel bearings	✓		
<b>Brakes</b>			
Performance	✓		
Hand Brake	✓		
<b>Tyres (lowest observed tread depth of tyres)</b>			
Left front	8.6	mm	
Right front	9.0	mm	
Left rear	9.0	mm	
Right rear	9.0	mm	
Spare	Yes		
<b>Suspension</b>			
Suspension performance	✓		
Steering performance	✓		
Shock absorbers	✓		
<b>Air Conditioning / Heater</b>			
Operation	✓		
<b>Electrical / Accessories</b>			
Head lights	✓		
Tail lights	✓		
Indicators	✓		
Dashboard warning lights	✓		
Wipers (front & rear)	✓		
Window winder FL	✓		
Window winder FR	✓		
Window winder RL	✓		
Window winder RR	✓		
Rear view mirrors	✓		
Radio (basic test only)	✓		
CD (basic test only)	✓		
Number of keys	1		
Central locking	✓		
Remote locking	✓		
Sat. Nav. (basic test only)			✓
Reversing camera			✓

Inspected by: Jason Young

Date: 22 May 2024

I have read and understood this condition guide. Name: ..... Signature: .....