


| | | |
|--------------------------------|------------------------------|--------------------------------|
| Make: Hyundai | Model: I30 | Body Style: Hatchback |
| Year: 2009 | Registration: GEF176 | Reg Expiry: 22 Jul 2024 |
| WoF Expiry: 05 Sep 2024 | Odometer: 124,168 Kms | Good No: 25793363 |
| VIN: KMHDB51DR9U16530 | Next Service: | Service History: No |

Note: This report is not a warranty

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

Key:
 S = scratch
 D = dent
 R = rust
 PT = paint defect
 C = crack
 P = pin dent
 * = decals
 SC = stone chips
 W = significant scuffs

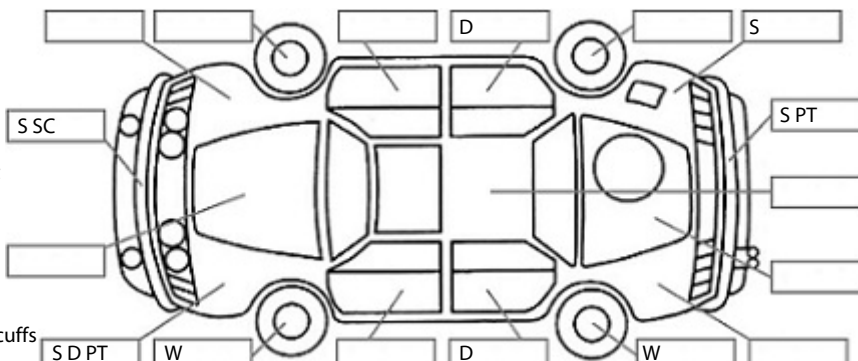

Body Inspection Comments
 Left wing mirror cover scratched.

Note: some defects & blemishes may not be displayed in the diagram

Conditions During Body Inspection: Wet

Under Carriage & Under Bonnet Inspection Comments
 Front wheel drive.
 Minor oil leak in engine bay.

Interior Comments

| | |
|-----------|---------|
| Seats | Good |
| Carpets | Average |
| Panels | Average |
| Dashboard | Good |

General Comments
 Front fog lights NW.
 Rear wiper blade torn.
 Passenger sun visor mirror cover broken.
 Engine vibration.
 Rattle noise when cold start.

Road Conditions During Test Drive: Dry

Engine Timing Mechanism: Timing Chain
 Evidence of Cam Belt Replacement: Not Applicable Kms:

| | Pass | Fail | N/A |
|---|------|------|-----|
| Engine | | | |
| Oil level | ✓ | | |
| Smoke & fumes | ✓ | | |
| Performance | ✓ | | |
| Noise | ✓ | | |
| Cooling System | | | |
| Coolant condition | ✓ | | |
| Performance | ✓ | | |
| Radiator / Hoses (visual) | ✓ | | |
| Transmission | | | |
| Operation | ✓ | | |
| Noise | ✓ | | |
| Clutch | | | ✓ |
| CV joints | ✓ | | |
| Wheel bearings | ✓ | | |
| Brakes | | | |
| Performance | ✓ | | |
| Hand Brake | ✓ | | |
| Tyres (lowest observed tread depth of tyres) | | | |
| Left front | 5 | mm | |
| Right front | 5 | mm | |
| Left rear | 7 | mm | |
| Right rear | 7 | mm | |
| Spare | | Yes | |
| Suspension | | | |
| Suspension performance | ✓ | | |
| Steering performance | ✓ | | |
| Shock absorbers | ✓ | | |
| Air Conditioning / Heater | | | |
| Operation | ✓ | | |
| Electrical / Accessories | | | |
| Head lights | ✓ | | |
| Tail lights | ✓ | | |
| Indicators | ✓ | | |
| Dashboard warning lights | ✓ | | |
| Wipers (front & rear) | ✓ | | |
| Window winder FL | ✓ | | |
| Window winder FR | ✓ | | |
| Window winder RL | ✓ | | |
| Window winder RR | ✓ | | |
| Rear view mirrors | ✓ | | |
| Radio (basic test only) | ✓ | | |
| CD (basic test only) | ✓ | | |
| Number of keys | 1 | | |
| Central locking | ✓ | | |
| Remote locking | ✓ | | |
| Sat. Nav. (basic test only) | | | ✓ |
| Reversing camera | | | ✓ |

Inspected by: Takaya Murayama Date: 24 Jun 2024

I have read and understood this condition guide. Name: Signature: