


<b>Make:</b> Suzuki	<b>Model:</b> Swift	<b>Body Style:</b> Hatchback
<b>Year:</b> 2008	<b>Registration:</b> ESW624	<b>Reg Expiry:</b> 11 Jan 2025
<b>WoF Expiry:</b> 29 Apr 2025	<b>Odometer:</b> 70,953 Kms	<b>Good No:</b> 25847753
<b>VIN:</b> JSAE2C21S00426234	<b>Next Service:</b> 80192	<b>Service History:</b> No

**Note: This report is not a warranty**

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

**Key:**  
 S = scratch  
 D = dent  
 R = rust  
 PT = paint defect  
 C = crack  
 P = pin dent  
 \* = decals  
 SC = stone chips  
 W = significant scuffs

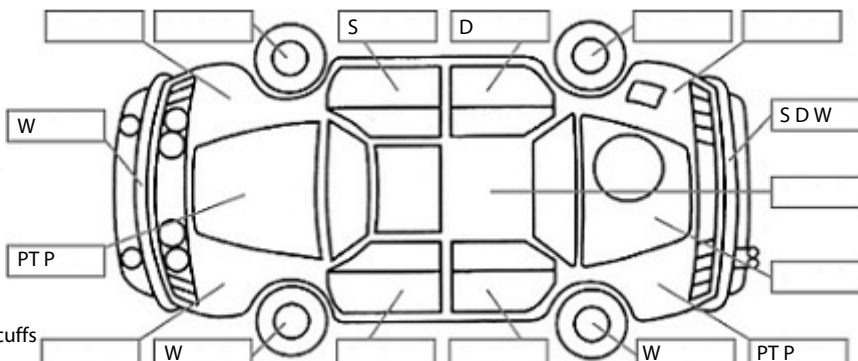

**Body Inspection Comments**  
 Front and rear bumpers impact damage

Note: some defects & blemishes may not be displayed in the diagram

Conditions During Body Inspection: Dry

**Under Carriage & Under Bonnet Inspection Comments**  
 Oil leaking from engine , play in right front wheel .  
 FWD

**Interior Comments**

Seats	Good
Carpets	Good
Panels	Good
Dashboard	Good

**General Comments**  
 Front brakes shudder when braking .  
 Low on power, needs a tune up.  
 Ac 15c , heater 45c  
 Fault codes p1878 current/ torque converter clutch ,  
 Central locking does not work when using key on driver's door ,remote keys not working .

Road Conditions During Test Drive: Dry

Engine Timing Mechanism: Timing Chain  
 Evidence of Cam Belt Replacement: Not Applicable Kms:

	Pass	Fail	N/A
<b>Engine</b>			
Oil level	✓		
Smoke & fumes	✓		
Performance		✓	
Noise	✓		
<b>Cooling System</b>			
Coolant condition	✓		
Performance	✓		
Radiator / Hoses (visual)	✓		
<b>Transmission</b>			
Operation	✓		
Noise	✓		
Clutch			✓
CV joints	✓		
Wheel bearings	✓		
<b>Brakes</b>			
Performance	✓		
Hand Brake	✓		
<b>Tyres</b> (lowest observed tread depth of tyres)			
Left front	5	mm	
Right front	5	mm	
Left rear	6	mm	
Right rear	6	mm	
Spare		Yes	
<b>Suspension</b>			
Suspension performance	✓		
Steering performance	✓		
Shock absorbers	✓		
<b>Air Conditioning / Heater</b>			
Operation		✓	
<b>Electrical / Accessories</b>			
Head lights	✓		
Tail lights	✓		
Indicators	✓		
Dashboard warning lights	✓		
Wipers (front & rear)	✓		
Window winder FL	✓		
Window winder FR	✓		
Window winder RL	✓		
Window winder RR	✓		
Rear view mirrors	✓		
Radio (basic test only)	✓		
CD (basic test only)			✓
Number of keys	2		
Central locking		✓	
Remote locking		✓	
Sat. Nav. (basic test only)			✓
Reversing camera			✓

Inspected by: Allan Young Date: 27 Jun 2024

I have read and understood this condition guide. Name: ..... Signature: .....