


<b>Make:</b> Volkswagen	<b>Model:</b> Polo	<b>Body Style:</b> Hatchback
<b>Year:</b> 2012	<b>Registration:</b> GEJ566	<b>Reg Expiry:</b> 15 Jan 2025
<b>WoF Expiry:</b> 23 Feb 2025	<b>Odometer:</b> 103,530 Kms	<b>Good No:</b> 26212929
<b>VIN:</b> WVVZZZ6RZCY53378	<b>Next Service:</b> 114200	<b>Service History:</b> No

**Note: This report is not a warranty**

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

**Key:**  
 S = scratch  
 D = dent  
 R = rust  
 PT = paint defect  
 C = crack  
 P = pin dent  
 \* = decals  
 SC = stone chips  
 W = significant scuffs

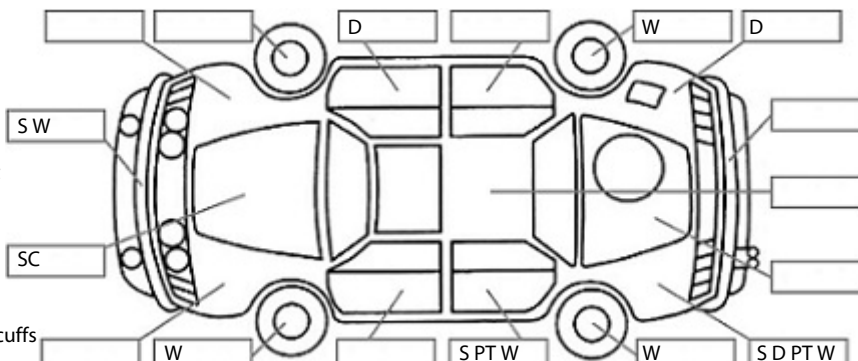

**Body Inspection Comments**  
 Add diagnosed inter manifold leaking air did smoke test.

Note: some defects & blemishes may not be displayed in the diagram

Conditions During Body Inspection: Dry

**Under Carriage & Under Bonnet Inspection Comments**  
 FWD  
 Both rear tyres wearing on outside tread  
 Centre armrest broken .

**Interior Comments**

Seats	Good
Carpets	Good
Panels	Good
Dashboard	Good

**General Comments**  
 Small headlights not working,  
 Fault codes P030300 cylinder 3, P 030200 cylinder 2,P03000 random/ multiple Misfire,P010600 manifold abs ,pressure or bar . 01272000 central air flap motor 00457:013 vehicle electrical system module. C108000 left/ right hand switch

Road Conditions During Test Drive: Dry

Engine Timing Mechanism: Timing Chain  
 Evidence of Cam Belt Replacement: Not Applicable Kms:

	Pass	Fail	N/A
<b>Engine</b>			
Oil level	✓		
Smoke & fumes	✓		
Performance	✓		
Noise	✓		
<b>Cooling System</b>			
Coolant condition	✓		
Performance	✓		
Radiator / Hoses (visual)	✓		
<b>Transmission</b>			
Operation	✓		
Noise	✓		
Clutch			✓
CV joints	✓		
Wheel bearings	✓		
<b>Brakes</b>			
Performance	✓		
Hand Brake	✓		
<b>Tyres</b> (lowest observed tread depth of tyres)			
Left front	6	mm	
Right front	6	mm	
Left rear	3	mm	
Right rear	3	mm	
Spare		Yes	
<b>Suspension</b>			
Suspension performance	✓		
Steering performance	✓		
Shock absorbers	✓		
<b>Air Conditioning / Heater</b>			
Operation	✓		
<b>Electrical / Accessories</b>			
Head lights		✓	
Tail lights	✓		
Indicators	✓		
Dashboard warning lights	✓		
Wipers (front & rear)	✓		
Window winder FL	✓		
Window winder FR	✓		
Window winder RL	✓		
Window winder RR	✓		
Rear view mirrors	✓		
Radio (basic test only)	✓		
CD (basic test only)	✓		
Number of keys	2		
Central locking	✓		
Remote locking	✓		
Sat. Nav. (basic test only)			✓
Reversing camera			✓

Inspected by: Marlon Espena Date: 04 Sep 2024

I have read and understood this condition guide. Name: ..... Signature: .....