

Basic Vehicle Condition Guide

Report ID: 26,246,258


Version: 3

Created: 29 Aug 2024

Make: Model: Holden Adventra **Body Style:** SUV Year: 2006 Registration: FAU817 **Reg Expiry:** 17 Aug 2024 WoF Expiry: **Odometer:** 25 Mar 2025 276,269 Kms **Good No:** 26246258 VIN: 6G1ZM84706L810250 Next Service: 282,000 **Service History:**

Note: This report is not a warranty

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

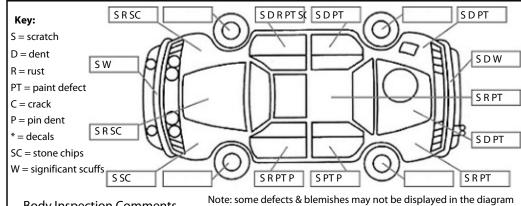

Body Inspection Comments

Rear Glass Access Door Not Latching Surface Rust on Sill Seams, Above Windscreen, Left Rear Window Minor Stone Chips Windscreen Condensation Taillights

Conditions During Body Inspection: Wet

Under Carriage & Under Bonnet Inspection Comments

Oil Leak - Dripping Onto Accessory Belt Surface Rust Upper Radiator Support Transmission Mount Bushing Cracked Left Rear Inner CV Boot Seepage

Interior Comments

Seats	Below Average
Carpets	Average
Panels	Average
Dashboard	Average

General Comments

Rear Wiper N/W Rear Windows Grinding Noise ABS & Engine Light On Ticking Noise from Accessories Handbrake Weak

Road Conditions During Test Drive: Wet

Engine Timing Mechanism: Timing Chain

Evidence of Cam Belt Replacement: Not Applicable Kms:

28 Aug 2024 Inspected by: Samuel Weir

Name:

	Pass	Fail	N/A
Engine			1
Oil level	~		
Smoke & fumes	\(\times \)		
Performance	~		
Noise	~		
Cooling System			
Coolant condition	~		
Performance	~		
Radiator / Hoses (visual)	~		
Transmission			
Operation	~		
Noise	~		
Clutch			~
CV joints	~		
Wheel bearings	V		
Brakes			
Performance	V		
Hand Brake		~	
Tyres (lowest observed trea	l d depth	of tyre	 es)
Left front	1	.5	mm
Right front	4.0		mm
Left rear		3.5	
Right rear		3.5	
Spare	3	3.5 Yes	
Suspension		163	
Suspension performance	·		
Steering performance	~		
Shock absorbers	11		
	\ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \		
Air Conditioning / Heater	1.4		1
Operation	<i>V</i>		
Electrical / Accessories			1
Head lights	<i>'</i>		
Tail lights	<i>'</i>		
Indicators	'		
Dashboard warning lights		~	
Wipers (front & rear)		~	
Window winder FL	~		
Window winder FR	~		
Window winder RL	~		
Window winder RR	/		
Rear view mirrors	~		
Radio (basic test only)	~		
CD (basic test only)	~		
Number of keys	1		
Central locking	~		
Remote locking	~		
Sat. Nav. (basic test only)			~
Reversing camera			~

Signature: