

Basic Vehicle Condition Guide

Report ID: 26,260,700


Version: 2

Created: 27 Aug 2024

Make: Model: Holden Cruze **Body Style:** Sedan Year: 2013 Registration: MKE322 Reg Expiry: 17 Sep 2024 **Odometer:** WoF Expiry: 02 Feb 2025 200,248 Kms **Good No:** 26260700 VIN: 6G1PD5EM0EL944572 Next Service: 205,600 Kms **Service History:**

Note: This report is not a warranty

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

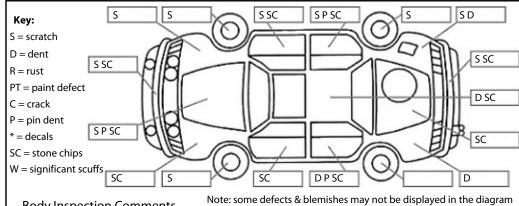

Body Inspection Comments

Hail damage on roof and bonnet. Missing aerial.

Conditions During Body Inspection: Dry

Under Carriage & Under Bonnet Inspection Comments

Engine oil leak.

Interior Comments			
Seats	Average		
Carpets	Average, drivers floor mat torn.		
Panels	Average		
Dashboard	Average, steering wheel worn.		

General Comments

Road Conditions During Test Drive: Dry

Engine Timing Mechanism: Cambelt

Evidence of Cam Belt Replacement: Kms: 151,000 Yes

22 Aug 2024 Inspected by: Troy Smith

	Pass	Fail	N/A
Engine			
Oil level	~		
Smoke & fumes	~		
Performance	\(\times \)		
Noise	~		
Cooling System			
Coolant condition	~		
Performance	~		
Radiator / Hoses (visual)	~		
Transmission			
Operation	V		
Noise	~		
Clutch			~
CV joints	~		
Wheel bearings	~		
Brakes			
Performance	~		
Hand Brake	~		
Tyres (lowest observed tread	d depth	of tyre	es)
Left front	2.5		mm
Right front	2.5		mm
Left rear	5.5		mm
Right rear	5.5		mm
Spare		Yes	
Suspension			
Suspension performance	~		
Steering performance	V		
Shock absorbers	~		
Air Conditioning / Heater			
Operation	~		
Electrical / Accessories			
Head lights	~		
Tail lights	~		
Indicators	V		
Dashboard warning lights	~		
Wipers (front & rear)	~		
Window winder FL	~		
Window winder FR	~		
Window winder RL	~		
Window winder RR	~		
Rear view mirrors	~		
Radio (basic test only)	~		
CD (basic test only)	~		
Number of keys	1		
Central locking	~		
Remote locking	~		
Sat. Nav. (basic test only)			~
Reversing camera	l		. <i>_</i>

I have read and understood this condition guide.

Name:

Signature:

Reversing camera