


<b>Make:</b> Volkswagen	<b>Model:</b> Golf	<b>Body Style:</b> Wagon
<b>Year:</b> 2005	<b>Registration:</b> JCA262	<b>Reg Expiry:</b> 11 Nov 2024
<b>WoF Expiry:</b> 09 Aug 2025	<b>Odometer:</b> 125,000 Kms	<b>Good No:</b> 26263392
<b>VIN:</b> WVGZZZ1TZ5W02906	<b>Next Service:</b> 124,000kms	<b>Service History:</b> No

**Note: This report is not a warranty**

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

**Key:**

- S = scratch
- D = dent
- R = rust
- PT = paint defect
- C = crack
- P = pin dent
- \* = decals
- SC = stone chips
- W = significant scuffs

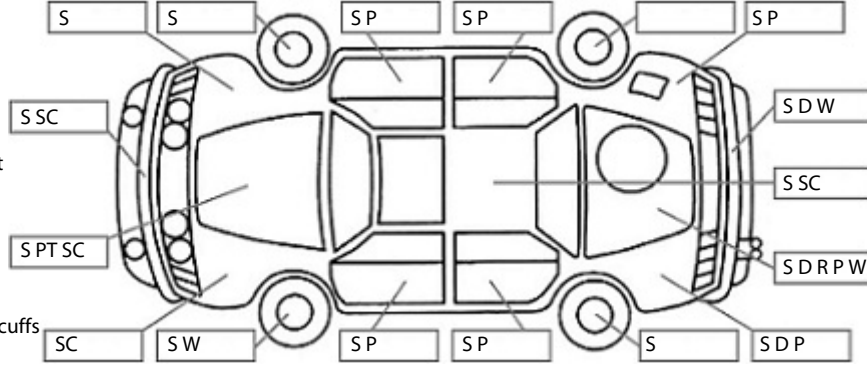

**Body Inspection Comments**

Note: some defects & blemishes may not be displayed in the diagram

Rear window washer is not working. Large crack in paint on bonnet. Rear heater vent on back of centre console is broken.

Conditions During Body Inspection: Dry

**Under Carriage & Under Bonnet Inspection Comments**

Oil weeping from right side output shaft seal on gearbox.

**Interior Comments**

Seats	Average
Carpets	Average
Panels	Average
Dashboard	Good

**General Comments**

Engine check light is on. Slight misfire on cold start up. Correct km's are 124,561kms. Interior roof lining is sagging. Catches broken on storage pocket on interior panel on tailgate, will not stay closed. A/C is not getting cold, needs attention. Button broken off panel on front of radio.

Road Conditions During Test Drive: Dry

Engine Timing Mechanism: Cambelt

Evidence of Cam Belt Replacement: No Kms:

	Pass	Fail	N/A
<b>Engine</b>			
Oil level	✓		
Smoke & fumes	✓		
Performance		✓	
Noise	✓		
<b>Cooling System</b>			
Coolant condition	✓		
Performance	✓		
Radiator / Hoses (visual)	✓		
<b>Transmission</b>			
Operation	✓		
Noise	✓		
Clutch			✓
CV joints	✓		
Wheel bearings	✓		
<b>Brakes</b>			
Performance	✓		
Hand Brake	✓		
<b>Tyres</b> (lowest observed tread depth of tyres)			
Left front	3.2	mm	
Right front	3.2	mm	
Left rear	3.4	mm	
Right rear	4.2	mm	
Spare	N/A		
<b>Suspension</b>			
Suspension performance	✓		
Steering performance	✓		
Shock absorbers	✓		
<b>Air Conditioning / Heater</b>			
Operation		✓	
<b>Electrical / Accessories</b>			
Head lights	✓		
Tail lights	✓		
Indicators	✓		
Dashboard warning lights		✓	
Wipers (front & rear)	✓		
Window winder FL	✓		
Window winder FR	✓		
Window winder RL	✓		
Window winder RR	✓		
Rear view mirrors	✓		
Radio (basic test only)	✓		
CD (basic test only)	✓		
Number of keys	1		
Central locking	✓		
Remote locking	✓		
Sat. Nav. (basic test only)			✓
Reversing camera			✓

Inspected by: Jason Young

Date: 03 Sep 2024

I have read and understood this condition guide. Name: ..... Signature: .....