

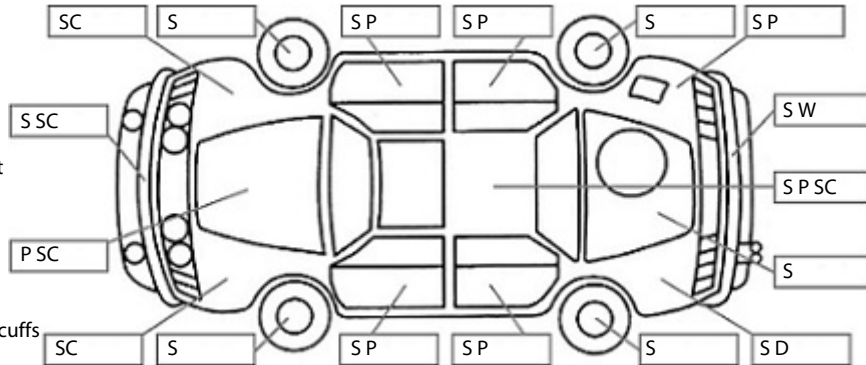
Make: Mitsubishi	Model: Outlander	Body Style: Wagon
Year: 2005	Registration: KFK601	Reg Expiry: 26 Dec 2024
WoF Expiry: 16 May 2025	Odometer: 246,775 Kms	Good No: 26300744
VIN: 7AT0CJ3MX16004450	Next Service: 233,608kms	Service History: No

Note: This report is not a warranty

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

Key:

- S = scratch
- D = dent
- R = rust
- PT = paint defect
- C = crack
- P = pin dent
- * = decals
- SC = stone chips
- W = significant scuffs


Body Inspection Comments

Note: some defects & blemishes may not be displayed in the diagram

Small stone crack in middle of windscreen. Bottom of front grille is not secured in place. Bottom part of left inner guard liner is broken off & missing.

Conditions During Body Inspection: Dry

Under Carriage & Under Bonnet Inspection Comments

Left in cv boot is split. Power steering fluid leaking from right side of steering rack. Engine oil service is overdue.

Interior Comments

Seats	Average
Carpets	Average
Panels	Average
Dashboard	Good

General Comments

Knocking coming from front suspension. A/C is not getting cold, needs attention. Tools for using vehicle jack are missing. Top edges on pocket that are on rear panels of both front seats are torn. Holes worn in carpet right front foot well area.

Road Conditions During Test Drive: Dry

Engine Timing Mechanism: Timing Chain
 Evidence of Cam Belt Replacement: Not Applicable Kms:

	Pass	Fail	N/A
Engine			
Oil level	✓		
Smoke & fumes	✓		
Performance	✓		
Noise	✓		
Cooling System			
Coolant condition	✓		
Performance	✓		
Radiator / Hoses (visual)	✓		
Transmission			
Operation	✓		
Noise	✓		
Clutch			✓
CV joints	✓		
Wheel bearings	✓		
Brakes			
Performance	✓		
Hand Brake	✓		
Tyres (lowest observed tread depth of tyres)			
Left front	3.4	mm	
Right front	3.6	mm	
Left rear	3.0	mm	
Right rear	4.5	mm	
Spare	Yes		
Suspension			
Suspension performance		✓	
Steering performance	✓		
Shock absorbers	✓		
Air Conditioning / Heater			
Operation		✓	
Electrical / Accessories			
Head lights	✓		
Tail lights	✓		
Indicators	✓		
Dashboard warning lights	✓		
Wipers (front & rear)	✓		
Window winder FL	✓		
Window winder FR	✓		
Window winder RL	✓		
Window winder RR	✓		
Rear view mirrors	✓		
Radio (basic test only)	✓		
CD (basic test only)	✓		
Number of keys	1		
Central locking	✓		
Remote locking	✓		
Sat. Nav. (basic test only)			✓
Reversing camera	✓		

Inspected by: Jason Young

Date: 11 Sep 2024

I have read and understood this condition guide. Name: Signature: