


<b>Make:</b> Toyota	<b>Model:</b> Hilux	<b>Body Style:</b> Utility
<b>Year:</b> 2011	<b>Registration:</b> FWL890	<b>Reg Expiry:</b> 10 Mar 2025
<b>WoF Expiry:</b> 27 Aug 2025	<b>Odometer:</b> 293,642 Kms	<b>Good No:</b> 26333799
<b>VIN:</b> MR0FZ22G501047932	<b>Next Service:</b> 296,500kms	<b>Service History:</b> No

**Note: This report is not a warranty**

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

**Key:**

- S = scratch
- D = dent
- R = rust
- PT = paint defect
- C = crack
- P = pin dent
- \* = decals
- SC = stone chips
- W = significant scuffs

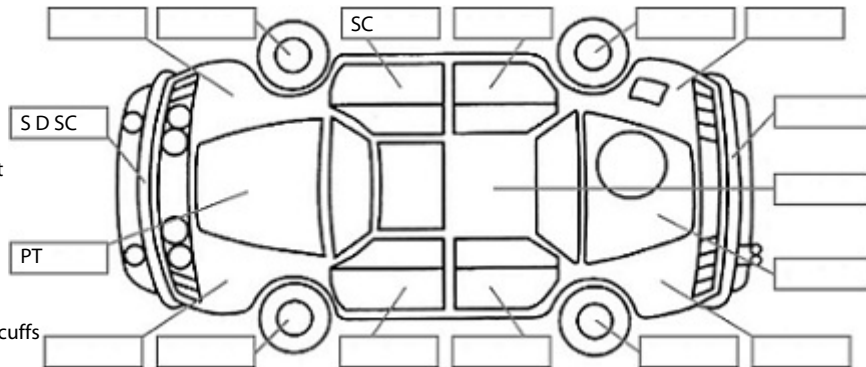

**Body Inspection Comments**

Note: some defects & blemishes may not be displayed in the diagram

- Grille broken.
- Front guard liners damaged.
- Left rear mud guard damaged.
- Some body panels repainted, minor defects.
- Chipped windscreen.
- Step plates rusty.
- Drivers window & windscreen scratched.

Conditions During Body Inspection: Dry

**Under Carriage & Under Bonnet Inspection Comments**

- Surface rust under carriage.
- Dents on crossmember & front of chassis.

**Interior Comments**

Seats	Average, fitted seat covers.
Carpets	Average
Panels	Headlining stained. console lid & gear knob worn.
Dashboard	S/Wheel worn, L/h cup holder face missing

**General Comments**

- L/F window only working from master switch.
- CD player not taking disc. A/C not cooling down.
- Gearbox issues, grinding & crunching, particularly 4WD high.
- Brakes worn attention suggested.

Road Conditions During Test Drive: Dry

Engine Timing Mechanism: Cambelt  
 Evidence of Cam Belt Replacement: No Kms:

	Pass	Fail	N/A
<b>Engine</b>			
Oil level	✓		
Smoke & fumes	✓		
Performance	✓		
Noise	✓		
<b>Cooling System</b>			
Coolant condition	✓		
Performance	✓		
Radiator / Hoses (visual)	✓		
<b>Transmission</b>			
Operation		✓	
Noise		✓	
Clutch		✓	
CV joints	✓		
Wheel bearings	✓		
<b>Brakes</b>			
Performance		✓	
Hand Brake	✓		
<b>Tyres</b> (lowest observed tread depth of tyres)			
Left front	13	mm	
Right front	13	mm	
Left rear	5	mm	
Right rear	5	mm	
Spare		Yes	
<b>Suspension</b>			
Suspension performance	✓		
Steering performance	✓		
Shock absorbers	✓		
<b>Air Conditioning / Heater</b>			
Operation		✓	
<b>Electrical / Accessories</b>			
Head lights	✓		
Tail lights	✓		
Indicators	✓		
Dashboard warning lights	✓		
Wipers (front & rear)	✓		
Window winder FL		✓	
Window winder FR	✓		
Window winder RL	✓		
Window winder RR	✓		
Rear view mirrors	✓		
Radio (basic test only)	✓		
CD (basic test only)		✓	
Number of keys	1		
Central locking	✓		
Remote locking	✓		
Sat. Nav. (basic test only)			✓
Reversing camera			✓

Inspected by: Daryll Timms

Date: 27 Sep 2024

I have read and understood this condition guide. Name: ..... Signature: .....