


| | | |
|--------------------------------|---------------------------------|--------------------------------|
| Make: Hyundai | Model: Iload | Body Style: Van |
| Year: 2016 | Registration: KCH674 | Reg Expiry: 02 Jan 2025 |
| WoF Expiry: 15 Nov 2024 | Odometer: 176,125 Kms | Good No: 26371236 |
| VIN: KMFWBX7KMHU8590 | Next Service: 186246 kms | Service History: Yes |

Note: This report is not a warranty

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

Key:

- S = scratch
- D = dent
- R = rust
- PT = paint defect
- C = crack
- P = pin dent
- * = decals
- SC = stone chips
- W = significant scuffs

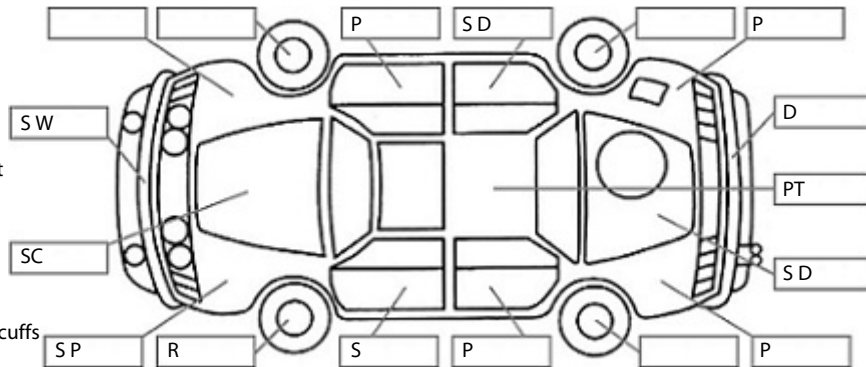

Note: some defects & blemishes may not be displayed in the diagram

Body Inspection Comments

- High stop light lens crack.
- Headliner marks/stains.
- FR door sill seal tear. Boot lid sill seal damage.
- Roof rust. (Seen from cargo area)
- Loose wiring from under driver seat.

Conditions During Body Inspection: Dry

Under Carriage & Under Bonnet Inspection Comments

- RWD
- Engine oil leaks.
- FL sill bent.

Interior Comments

| | |
|-----------|---------|
| Seats | Average |
| Carpets | Average |
| Panels | Average |
| Dashboard | Good |

General Comments

- Front seatbelts fraying.
- Rear wiper missing.

Road Conditions During Test Drive: Dry

Engine Timing Mechanism: Timing Chain
 Evidence of Cam Belt Replacement: Not Applicable Kms:

| | Pass | Fail | N/A |
|---|------|------|-----|
| Engine | | | |
| Oil level | ✓ | | |
| Smoke & fumes | ✓ | | |
| Performance | ✓ | | |
| Noise | ✓ | | |
| Cooling System | | | |
| Coolant condition | ✓ | | |
| Performance | ✓ | | |
| Radiator / Hoses (visual) | ✓ | | |
| Transmission | | | |
| Operation | ✓ | | |
| Noise | ✓ | | |
| Clutch | | | ✓ |
| CV joints | | | ✓ |
| Wheel bearings | ✓ | | |
| Brakes | | | |
| Performance | ✓ | | |
| Hand Brake | ✓ | | |
| Tyres (lowest observed tread depth of tyres) | | | |
| Left front | 4.0 | mm | |
| Right front | 8.0 | mm | |
| Left rear | 3.0 | mm | |
| Right rear | 4.0 | mm | |
| Spare | Yes | | |
| Suspension | | | |
| Suspension performance | ✓ | | |
| Steering performance | ✓ | | |
| Shock absorbers | ✓ | | |
| Air Conditioning / Heater | | | |
| Operation | ✓ | | |
| Electrical / Accessories | | | |
| Head lights | ✓ | | |
| Tail lights | ✓ | | |
| Indicators | ✓ | | |
| Dashboard warning lights | ✓ | | |
| Wipers (front & rear) | | ✓ | |
| Window winder FL | ✓ | | |
| Window winder FR | ✓ | | |
| Window winder RL | | | ✓ |
| Window winder RR | | | ✓ |
| Rear view mirrors | ✓ | | |
| Radio (basic test only) | ✓ | | |
| CD (basic test only) | | | ✓ |
| Number of keys | 2 | | |
| Central locking | ✓ | | |
| Remote locking | ✓ | | |
| Sat. Nav. (basic test only) | | | ✓ |
| Reversing camera | ✓ | | |

Inspected by: Eleoit Kumar

Date: 23 Oct 2024

I have read and understood this condition guide. Name: Signature: