

Basic Vehicle Condition Guide

Report ID: 26,389,523

Version: 1


Created: 29 Oct 2024

Pass Fail N/A

Make: Model: **BMW** 5251 **Body Style:** Sedan Year: 2009 Registration: LMB842 **Reg Expiry:** 27 Sep 2024 WoF Expiry: **Odometer:** 08 Feb 2025 155,059 Kms **Good No:** 26389523 VIN: WBANU52080CZ8605 Next Service: 124,000 **Service History:**

Note: This report is not a warranty

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

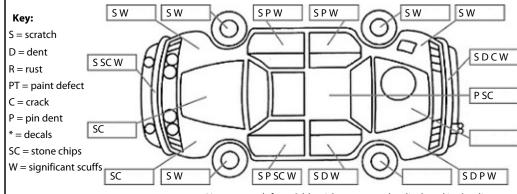

Body Inspection Comments

Note: some defects & blemishes may not be displayed in the diagram

Front bumper dislodged, Water in LH fog lamp, Bonnet won't stay up, Hole in rear bumper,

Conditions During Body Inspection: Dry

Under Carriage & Under Bonnet Inspection Comments

Rear wheel drive, Rear main seal leaking, Engine sump leaking, Front crank seal leaking, Engine front cover leaking, Rocker cover leaking, Oil filter housing leaking, Engine oil at halfway, Coolant on "Min" mark.

Interior Comments

Seats	Average
Carpets	Good
Panels	Good
Dashboard	Good

General Comments

LH fog lamp not working, Wipers need replacing, Reverse lamp not working, Roof lining coming down, Aircon not working, Seats stained, Handbrake excessive travel, Oil burning smell.

Road Conditions During Test Drive: Dry

Engine Timing Mechanism: Timing Chain

Evidence of Cam Belt Replacement: Not Applicable Kms:

Inspected by: Andre Richardson Date: 29 Oct 2024

			<u> </u>	
Engine				
Oil level		~		
Smoke & fumes	~			
Performance	/			
Noise	/			
Cooling System				
Coolant condition		~		
Performance	~			
Radiator / Hoses (visual)	/			
Transmission				
Operation	~			
Noise	~			
Clutch			~	
CV joints	~			
Wheel bearings	~			
Brakes				
Performance	~			
Hand Brake		~		
Tyres (lowest observed treac	l depth	of tyre	es)	
Left front		5	mm	
Right front		 5	mm	
Left rear		4	mm	
Right rear	4		mm	
Spare	No			
Suspension				
Suspension performance	~			
Steering performance	~			
Shock absorbers	~			
Air Conditioning / Heater				
Operation		V		
Electrical / Accessories				
Head lights		V		
Tail lights		~		
Indicators	~			
Dashboard warning lights	~			
Wipers (front & rear)		~		
Window winder FL	~			
Window winder FR	\(\times \) \(\t			
Window winder RL	~			
Window winder RR	~			
Rear view mirrors	~			
Radio (basic test only)	~			
CD (basic test only)	· ·			
Number of keys	1			
Central locking	· ·			
Remote locking	~		-	
Sat. Nav. (basic test only)	~			
Reversing camera	V			
versing carriera				

I have read and understood this condition guide.

Name:

Signature: