


|                                |                                 |                                |
|--------------------------------|---------------------------------|--------------------------------|
| <b>Make:</b> Holden            | <b>Model:</b> Cruze             | <b>Body Style:</b> Wagon       |
| <b>Year:</b> 2015              | <b>Registration:</b> JAW510     | <b>Reg Expiry:</b> 30 Mar 2025 |
| <b>WoF Expiry:</b> 20 May 2025 | <b>Odometer:</b> 210,001 Kms    | <b>Good No:</b> 26397731       |
| <b>VIN:</b> KL3JA35MJEK617317  | <b>Next Service:</b> 215,700kms | <b>Service History:</b> Yes    |

**Note: This report is not a warranty**

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

**Key:**

- S = scratch
- D = dent
- R = rust
- PT = paint defect
- C = crack
- P = pin dent
- \* = decals
- SC = stone chips
- W = significant scuffs

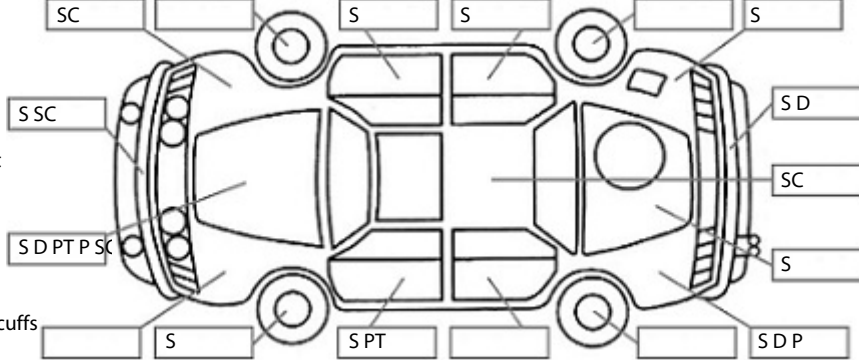

**Body Inspection Comments**

Note: some defects & blemishes may not be displayed in the diagram

Plastic tow hook cover missing out of right side of front bumper.

Conditions During Body Inspection: Dry

**Under Carriage & Under Bonnet Inspection Comments**

Minor oil leak from around bottom of cam belt cover & water pump is weeping coolant. Oil weeping around bottom of gearbox & from between engine/gearbox.

**Interior Comments**

|           |      |
|-----------|------|
| Seats     | Good |
| Carpets   | Good |
| Panels    | Good |
| Dashboard | Good |

**General Comments**

A bit of plastic broken off left front seat belt buckle. Correct km's are 209,416kms.

Road Conditions During Test Drive: Dry

Engine Timing Mechanism: Cambelt  
Evidence of Cam Belt Replacement: No Kms:

|   | Pass | Fail | N/A |
|---|------|------|-----|
| <b>Engine</b>                                       |      |      |     |
| Oil level   | ✓    |      |     |
| Smoke & fumes                                       | ✓    |      |     |
| Performance   | ✓    |      |     |
| Noise   | ✓    |      |     |
| <b>Cooling System</b>                               |      |      |     |
| Coolant condition                                   | ✓    |      |     |
| Performance   | ✓    |      |     |
| Radiator / Hoses (visual)                           | ✓    |      |     |
| <b>Transmission</b>                                 |      |      |     |
| Operation   | ✓    |      |     |
| Noise   | ✓    |      |     |
| Clutch  |      |      | ✓   |
| CV joints   | ✓    |      |     |
| Wheel bearings                                      | ✓    |      |     |
| <b>Brakes</b>                                       |      |      |     |
| Performance   | ✓    |      |     |
| Hand Brake  | ✓    |      |     |
| <b>Tyres</b> (lowest observed tread depth of tyres) |      |      |     |
| Left front  | 5.0  | mm   |     |
| Right front   | 5.2  | mm   |     |
| Left rear   | 3.0  | mm   |     |
| Right rear  | 3.0  | mm   |     |
| Spare   | Yes  |      |     |
| <b>Suspension</b>                                   |      |      |     |
| Suspension performance                              | ✓    |      |     |
| Steering performance                                | ✓    |      |     |
| Shock absorbers                                     | ✓    |      |     |
| <b>Air Conditioning / Heater</b>                    |      |      |     |
| Operation   | ✓    |      |     |
| <b>Electrical / Accessories</b>                     |      |      |     |
| Head lights   | ✓    |      |     |
| Tail lights   | ✓    |      |     |
| Indicators  | ✓    |      |     |
| Dashboard warning lights                            | ✓    |      |     |
| Wipers (front & rear)                               | ✓    |      |     |
| Window winder FL                                    | ✓    |      |     |
| Window winder FR                                    | ✓    |      |     |
| Window winder RL                                    | ✓    |      |     |
| Window winder RR                                    | ✓    |      |     |
| Rear view mirrors                                   | ✓    |      |     |
| Radio (basic test only)                             | ✓    |      |     |
| CD (basic test only)                                | ✓    |      |     |
| Number of keys                                      | 1    |      |     |
| Central locking                                     | ✓    |      |     |
| Remote locking                                      | ✓    |      |     |
| Sat. Nav. (basic test only)                         |      |      | ✓   |
| Reversing camera                                    |      |      | ✓   |

Inspected by: Jason Young

Date: 01 Nov 2024

I have read and understood this condition guide. Name: ..... Signature: .....