


<b>Make:</b> Mazda	<b>Model:</b> Mazda6	<b>Body Style:</b> Wagon
<b>Year:</b> 2007	<b>Registration:</b> ECY140	<b>Reg Expiry:</b> 15 Feb 2025
<b>WoF Expiry:</b> 23 Feb 2025	<b>Odometer:</b> 279,934 Kms	<b>Good No:</b> 26415597
<b>VIN:</b> JM0GY103200305209	<b>Next Service:</b> 280,000kms	<b>Service History:</b> Yes

**Note: This report is not a warranty**

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

**Key:**

- S = scratch
- D = dent
- R = rust
- PT = paint defect
- C = crack
- P = pin dent
- \* = decals
- SC = stone chips
- W = significant scuffs

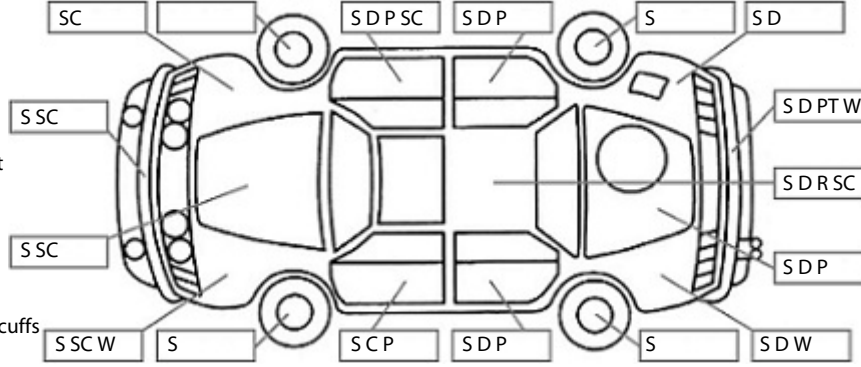

**Body Inspection Comments**

Note: some defects & blemishes may not be displayed in the diagram

Large star shaped crack in left side bottom corner of windscreen. Crack in left side wing mirror cover. Large dent in left rear door panel. Large dent in right side sill, under driver's door.

Conditions During Body Inspection: Dry

**Under Carriage & Under Bonnet Inspection Comments**

Oil weeping from gearbox & from between engine/gearbox area. Starting to develop underbody surface rust.

**Interior Comments**

Seats	Average
Carpets	Average
Panels	Average
Dashboard	Average

**General Comments**

A/C is not getting very cold, needs attention. Steering wheel covering has a hole worn in it. Head lights are not working on low beam. Screw holes in right side of dashboard.

Road Conditions During Test Drive: Dry

Engine Timing Mechanism: Timing Chain  
Evidence of Cam Belt Replacement: Not Applicable Kms:

	Pass	Fail	N/A
<b>Engine</b>			
Oil level	✓		
Smoke & fumes	✓		
Performance	✓		
Noise	✓		
<b>Cooling System</b>			
Coolant condition	✓		
Performance	✓		
Radiator / Hoses (visual)	✓		
<b>Transmission</b>			
Operation	✓		
Noise	✓		
Clutch			✓
CV joints	✓		
Wheel bearings	✓		
<b>Brakes</b>			
Performance	✓		
Hand Brake	✓		
<b>Tyres</b> (lowest observed tread depth of tyres)			
Left front	5.0	mm	
Right front	5.0	mm	
Left rear	5.0	mm	
Right rear	5.0	mm	
Spare	Yes		
<b>Suspension</b>			
Suspension performance	✓		
Steering performance	✓		
Shock absorbers	✓		
<b>Air Conditioning / Heater</b>			
Operation		✓	
<b>Electrical / Accessories</b>			
Head lights		✓	
Tail lights	✓		
Indicators	✓		
Dashboard warning lights	✓		
Wipers (front & rear)	✓		
Window winder FL	✓		
Window winder FR	✓		
Window winder RL	✓		
Window winder RR	✓		
Rear view mirrors	✓		
Radio (basic test only)	✓		
CD (basic test only)	✓		
Number of keys	2		
Central locking	✓		
Remote locking	✓		
Sat. Nav. (basic test only)			✓
Reversing camera			✓

Inspected by: Jason Young

Date: 15 Nov 2024

I have read and understood this condition guide. Name: ..... Signature: .....