

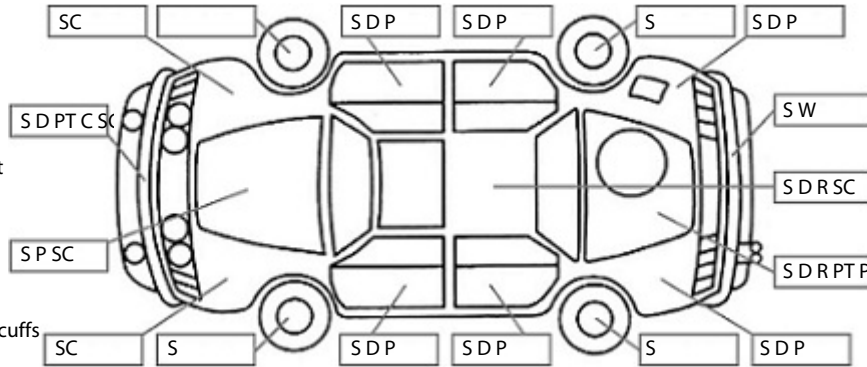
Make: Mitsubishi	Model: L300	Body Style: Van
Year: 2006	Registration: DNJ727	Reg Expiry: 24 Mar 2025
WoF Expiry: 07 Jul 2025	Odometer: 236,178 Kms	Good No: 26422463
VIN: JMASNPO5V7A800215	Next Service: 239,000kms	Service History: No

Note: This report is not a warranty

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

Key:

- S = scratch
- D = dent
- R = rust
- PT = paint defect
- C = crack
- P = pin dent
- * = decals
- SC = stone chips
- W = significant scuffs


Body Inspection Comments

Note: some defects & blemishes may not be displayed in the diagram

Large dent & crack in left bottom corner of front bumper. Cracks & holes on interior panels in rear cargo area of van.

Conditions During Body Inspection: Dry

Under Carriage & Under Bonnet Inspection Comments

Minor oil leak from bottom of cam belt cover, left side of engine block & from between engine/gearbox area.

Interior Comments

Seats	Poor
Carpets	Poor
Panels	Average
Dashboard	Average

General Comments

Large hole in base pad of driver's seat. Holes worn in carpet & carpet is very dirty. Dashboard ash tray is missing.

Road Conditions During Test Drive: Dry

Engine Timing Mechanism: Cambelt

Evidence of Cam Belt Replacement: Yes Kms: 202,229

	Pass	Fail	N/A
Engine			
Oil level	✓		
Smoke & fumes	✓		
Performance	✓		
Noise	✓		
Cooling System			
Coolant condition	✓		
Performance	✓		
Radiator / Hoses (visual)	✓		
Transmission			
Operation	✓		
Noise	✓		
Clutch	✓		
CV joints			✓
Wheel bearings	✓		
Brakes			
Performance	✓		
Hand Brake	✓		
Tyres (lowest observed tread depth of tyres)			
Left front	6.0	mm	
Right front	5.2	mm	
Left rear	2.0	mm	
Right rear	3.0	mm	
Spare	Yes		
Suspension			
Suspension performance	✓		
Steering performance	✓		
Shock absorbers	✓		
Air Conditioning / Heater			
Operation			✓
Electrical / Accessories			
Head lights	✓		
Tail lights	✓		
Indicators	✓		
Dashboard warning lights	✓		
Wipers (front & rear)	✓		
Window winder FL	✓		
Window winder FR	✓		
Window winder RL			✓
Window winder RR			✓
Rear view mirrors	✓		
Radio (basic test only)	✓		
CD (basic test only)	✓		
Number of keys	1		
Central locking			✓
Remote locking			✓
Sat. Nav. (basic test only)			✓
Reversing camera			✓

Inspected by: Jason Young

Date: 15 Nov 2024

I have read and understood this condition guide.

Name:

Signature: