


| | | |
|--------------------------------|---------------------------------|--------------------------------|
| Make: Nissan | Model: Bluebird | Body Style: Sedan |
| Year: 2005 | Registration: HLS959 | Reg Expiry: 01 May 2025 |
| WoF Expiry: 01 Oct 2025 | Odometer: 132,107 Kms | Good No: 26433544 |
| VIN: 7AT0DH1EX14185690 | Next Service: 136,186kms | Service History: Yes |

Note: This report is not a warranty

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

Key:

- S = scratch
- D = dent
- R = rust
- PT = paint defect
- C = crack
- P = pin dent
- * = decals
- SC = stone chips
- W = significant scuffs

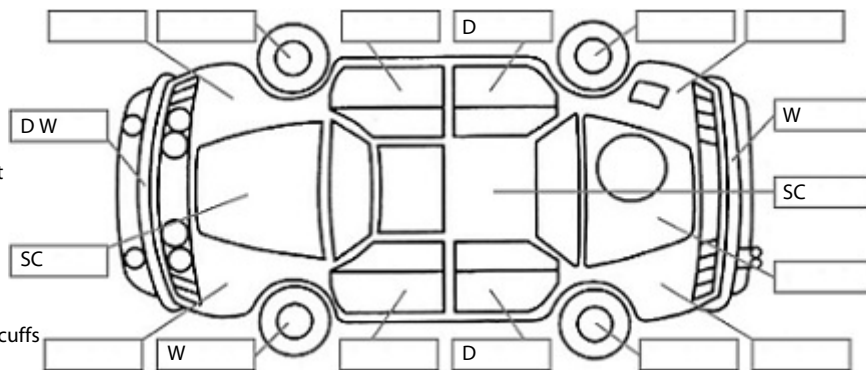

Body Inspection Comments

Note: some defects & blemishes may not be displayed in the diagram

Left front monsoon visor is broken.
Can not release shift from parking without using shift lock release button.

Conditions During Body Inspection: Dry

Under Carriage & Under Bonnet Inspection Comments

Oil leaking from around engine.
Left front CV outlet boots is torn and leaking.
All shock absorber boots are worn and torn.

Interior Comments

| | |
|-----------|---------|
| Seats | Average |
| Carpets | Average |
| Panels | Average |
| Dashboard | Average |

General Comments

Noise from power train(possible CV). Remote key is not operating (flat battery?)
Left door mirror auto fouling is not operating. Left rear power window is very slow(not aligned well in guide).
Tool is missing.
Right and left part of speed cluster illumination lights are not operating.

Road Conditions During Test Drive: Dry

Engine Timing Mechanism: Timing Chain
Evidence of Cam Belt Replacement: Not Applicable Kms:

| | Pass | Fail | N/A |
|---|------|------|-----|
| Engine | | | |
| Oil level | ✓ | | |
| Smoke & fumes | ✓ | | |
| Performance | ✓ | | |
| Noise | ✓ | | |
| Cooling System | | | |
| Coolant condition | ✓ | | |
| Performance | ✓ | | |
| Radiator / Hoses (visual) | ✓ | | |
| Transmission | | | |
| Operation | ✓ | | |
| Noise | ✓ | | |
| Clutch | | | ✓ |
| CV joints | | ✓ | |
| Wheel bearings | ✓ | | |
| Brakes | | | |
| Performance | ✓ | | |
| Hand Brake | ✓ | | |
| Tyres (lowest observed tread depth of tyres) | | | |
| Left front | 3.0 | mm | |
| Right front | 3.0 | mm | |
| Left rear | 5.0 | mm | |
| Right rear | 5.0 | mm | |
| Spare | Yes | | |
| Suspension | | | |
| Suspension performance | ✓ | | |
| Steering performance | ✓ | | |
| Shock absorbers | ✓ | | |
| Air Conditioning / Heater | | | |
| Operation | ✓ | | |
| Electrical / Accessories | | | |
| Head lights | ✓ | | |
| Tail lights | ✓ | | |
| Indicators | ✓ | | |
| Dashboard warning lights | ✓ | | |
| Wipers (front & rear) | ✓ | | |
| Window winder FL | ✓ | | |
| Window winder FR | ✓ | | |
| Window winder RL | | ✓ | |
| Window winder RR | ✓ | | |
| Rear view mirrors | ✓ | | |
| Radio (basic test only) | ✓ | | |
| CD (basic test only) | | | ✓ |
| Number of keys | 1 | | |
| Central locking | ✓ | | |
| Remote locking | | ✓ | |
| Sat. Nav. (basic test only) | | | ✓ |
| Reversing camera | | | ✓ |

Inspected by: Yuki Itohara

Date: 21 Nov 2024

I have read and understood this condition guide. Name: Signature: