


Make: Dodge	Model: Journey	Body Style: SUV
Year: 2015	Registration: JGF764	Reg Expiry: 28 Feb 2025
WoF Expiry: 08 Jan 2025	Odometer: 163,444 Kms	Good No: 26453754
VIN: 3C4PDCKG7FT643374	Next Service: 161,500kms	Service History: No

Note: This report is not a warranty

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

Key:

- S = scratch
- D = dent
- R = rust
- PT = paint defect
- C = crack
- P = pin dent
- * = decals
- SC = stone chips
- W = significant scuffs

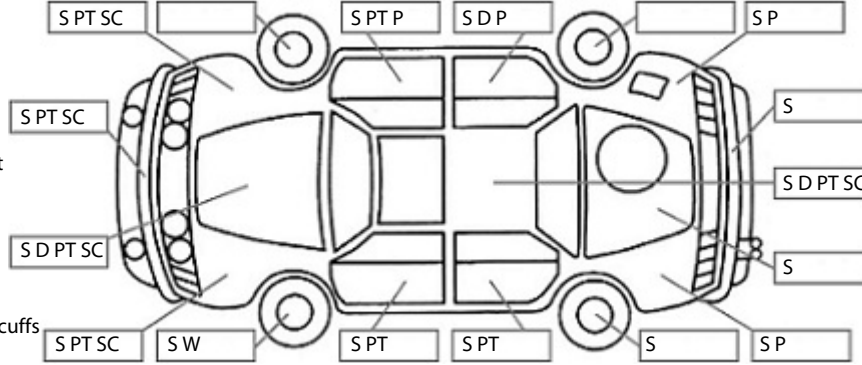

Body Inspection Comments

Note: some defects & blemishes may not be displayed in the diagram

Two stone cracks in left side of windscreen & fine scratches in middle of windscreen. White spots of paint overspray over front bumper & both front guards. Both front tyres need replacing, left front is below legal tread depth. Dent & scratches in right rear running board.

Conditions During Body Inspection: Dry

Under Carriage & Under Bonnet Inspection Comments

Oil weeping from between engine & gearbox. Right rear taillight lens has a crack in it.

Interior Comments

Seats	Good
Carpets	Good
Panels	Average
Dashboard	Good

General Comments

ABS & traction control light on dashboard display is staying on. Plastic base pad trim crack on drivers seat. A/C is not getting cold & ventilation system between left and right of cabin not working correctly. DVD player is not working.

Road Conditions During Test Drive: Dry

Engine Timing Mechanism: Timing Chain
Evidence of Cam Belt Replacement: Not Applicable Kms:

	Pass	Fail	N/A
Engine			
Oil level	✓		
Smoke & fumes	✓		
Performance	✓		
Noise	✓		
Cooling System			
Coolant condition	✓		
Performance	✓		
Radiator / Hoses (visual)	✓		
Transmission			
Operation	✓		
Noise	✓		
Clutch			✓
CV joints	✓		
Wheel bearings	✓		
Brakes			
Performance	✓		
Hand Brake	✓		
Tyres (lowest observed tread depth of tyres)			
Left front	1.2	mm	
Right front	1.5	mm	
Left rear	2.7	mm	
Right rear	2.0	mm	
Spare	Yes		
Suspension			
Suspension performance	✓		
Steering performance	✓		
Shock absorbers	✓		
Air Conditioning / Heater			
Operation		✓	
Electrical / Accessories			
Head lights	✓		
Tail lights		✓	
Indicators	✓		
Dashboard warning lights		✓	
Wipers (front & rear)	✓		
Window winder FL	✓		
Window winder FR	✓		
Window winder RL	✓		
Window winder RR	✓		
Rear view mirrors	✓		
Radio (basic test only)	✓		
CD (basic test only)	✓		
Number of keys	2		
Central locking	✓		
Remote locking	✓		
Sat. Nav. (basic test only)			✓
Reversing camera	✓		

Inspected by: Jason Young

Date: 02 Dec 2024

I have read and understood this condition guide. Name: Signature: