


| | | |
|--------------------------------|---------------------------------|--------------------------------|
| Make: Toyota | Model: Hilux | Body Style: Utility |
| Year: 2014 | Registration: HHD193 | Reg Expiry: 09 Mar 2025 |
| WoF Expiry: 05 Jul 2025 | Odometer: 65,256 Kms | Good No: 26465017 |
| VIN: MR0FZ29G90253128C | Next Service: no sticker | Service History: No |

Note: This report is not a warranty

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

Key:

- S = scratch
- D = dent
- R = rust
- PT = paint defect
- C = crack
- P = pin dent
- * = decals
- SC = stone chips
- W = significant scuffs

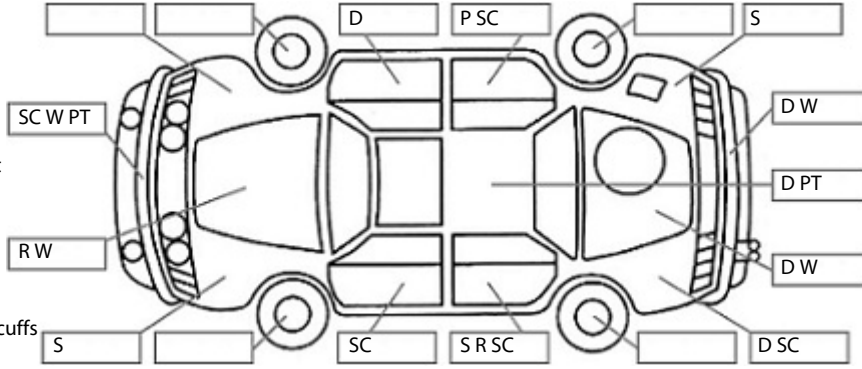

Body Inspection Comments

Note: some defects & blemishes may not be displayed in the diagram

- Right C pillar pin dented
- Left running board dented
- Tailgate hard to open
- Hole in front bumper

Conditions During Body Inspection: Dry

Under Carriage & Under Bonnet Inspection Comments

- Full underbody seal
- Rusty underbody engine cover
- Underbody rust
- Engine bay surface rust

Interior Comments

| | |
|-----------|---------|
| Seats | Average |
| Carpets | Average |
| Panels | Average |
| Dashboard | Average |

General Comments

Road Conditions During Test Drive: Dry

Engine Timing Mechanism: Cambelt
Evidence of Cam Belt Replacement: No Kms:

| | Pass | Fail | N/A |
|---|------|------|-----|
| Engine | | | |
| Oil level | ✓ | | |
| Smoke & fumes | ✓ | | |
| Performance | ✓ | | |
| Noise | ✓ | | |
| Cooling System | | | |
| Coolant condition | ✓ | | |
| Performance | ✓ | | |
| Radiator / Hoses (visual) | ✓ | | |
| Transmission | | | |
| Operation | ✓ | | |
| Noise | ✓ | | |
| Clutch | | | ✓ |
| CV joints | ✓ | | |
| Wheel bearings | ✓ | | |
| Brakes | | | |
| Performance | ✓ | | |
| Hand Brake | ✓ | | |
| Tyres (lowest observed tread depth of tyres) | | | |
| Left front | 9.0 | mm | |
| Right front | 10.0 | mm | |
| Left rear | 10.0 | mm | |
| Right rear | 10.0 | mm | |
| Spare | Yes | | |
| Suspension | | | |
| Suspension performance | ✓ | | |
| Steering performance | ✓ | | |
| Shock absorbers | ✓ | | |
| Air Conditioning / Heater | | | |
| Operation | ✓ | | |
| Electrical / Accessories | | | |
| Head lights | ✓ | | |
| Tail lights | ✓ | | |
| Indicators | ✓ | | |
| Dashboard warning lights | ✓ | | |
| Wipers (front & rear) | ✓ | | |
| Window winder FL | ✓ | | |
| Window winder FR | ✓ | | |
| Window winder RL | ✓ | | |
| Window winder RR | ✓ | | |
| Rear view mirrors | ✓ | | |
| Radio (basic test only) | ✓ | | |
| CD (basic test only) | ✓ | | |
| Number of keys | 2 | | |
| Central locking | ✓ | | |
| Remote locking | ✓ | | |
| Sat. Nav. (basic test only) | | | ✓ |
| Reversing camera | ✓ | | |

Inspected by: Sione Mae

Date: 03 Dec 2024

I have read and understood this condition guide. Name: Signature: