

Basic Vehicle Condition Guide

Report ID: 26,466,211


Version: 1

Created: 12 Dec 2024

Make: Model: Mazda CX-7 **Body Style:** SUV Year: 2012 Registration: **QSH165 Reg Expiry:** 28 Feb 2025 **WoF Expiry: Odometer:** 16 Jul 2025 290,576 Kms **Good No:** 26466211 VIN: JM0ER103200242830 **Next Service:** 298,000 Service History:

Note: This report is not a warranty

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

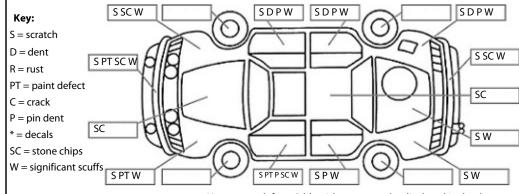

Body Inspection Comments

Note: some defects & blemishes may not be displayed in the diagram

Headlamps cloudy, Both tail lamps cloudy, Stone chips in C.V.A, All wheel centre caps missing, Top of RH/F door bent,

Conditions During Body Inspection: Wet

Under Carriage & Under Bonnet Inspection Comments

All wheel drive, Engine hunting at idle, Front differential leaking, Transmission leaking, Engine sump leaking, Engine front cover leaking, Oil filter housing leaking, No Oil on Dipstick!

Interior Comments

Seats	Poor
Carpets	Average
Panels	Good
Dashboard	Good

General Comments

Drivers seat base leather torn, Drivers seat base collapsed, Drivers seat side trim broken, Vehicle hard to start & runs rough on start up, All air vents broken, Rear wipers need replacing, Reverse camera not working Note:- Did Not Road Test due to No Oil!

Road Conditions During Test Drive: Dry

Engine Timing Mechanism: Timing Chain

Evidence of Cam Belt Replacement: Not Applicable Kms:

Inspected by: Andre Richardson

	Pass	Fail	N/A	
Engine				
Oil level		~		
Smoke & fumes			~	
Performance		/		
Noise			~	
Cooling System				
Coolant condition	~			
Performance			~	
Radiator / Hoses (visual)	~			
Transmission				
Operation			~	
Noise			~	
Clutch			~	
CV joints			~	
Wheel bearings			\(\times \) \(\t	
Brakes			•	
Performance			~	
Hand Brake	~			
Tyres (lowest observed tread	depth	of tyre	es)	
Left front	4	1	mm	
Right front	4	1	mm	
Left rear	4		mm	
Right rear	4		mm	
Spare		Yes		
Suspension				
Suspension performance			~	
Steering performance			~	
Shock absorbers	~			
Air Conditioning / Heater				
Operation	~			
Electrical / Accessories				
Head lights	~			
Tail lights	V			
Indicators	~			
Dashboard warning lights	~			
Wipers (front & rear)		~		
Window winder FL	~			
Window winder FR	~			
Window winder RL	~			
Window winder RR	~			
Rear view mirrors	~			
Radio (basic test only)	~			
CD (basic test only)	~			
Number of keys	2			
Central locking	~			
Remote locking	~			
Sat. Nav. (basic test only)			~	
Reversing camera		~		

I have read and understood this condition guide.

Name:

Signature:

12 Dec 2024

Date: