


<b>Make:</b> Volkswagen	<b>Model:</b> T5	<b>Body Style:</b> Van
<b>Year:</b> 2014	<b>Registration:</b> HTC144	<b>Reg Expiry:</b> 29 Oct 2025
<b>WoF Expiry:</b> 21 Feb 2025	<b>Odometer:</b> 213,042 Kms	<b>Good No:</b> 26481941
<b>VIN:</b> WV1ZZZ7HZEH122623	<b>Next Service:</b> 222,000	<b>Service History:</b> No

**Note: This report is not a warranty**

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

**Key:**

- S = scratch
- D = dent
- R = rust
- PT = paint defect
- C = crack
- P = pin dent
- \* = decals
- SC = stone chips
- W = significant scuffs

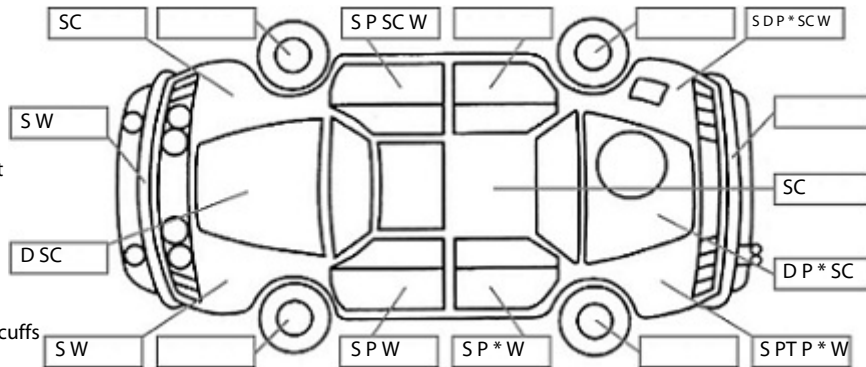

**Body Inspection Comments**

Note: some defects & blemishes may not be displayed in the diagram

Sliding door hard to close, LH tail lamp damaged by chemicals, Tailgate interior trims missing, Tailgate bent & hard to close, LH wing mirror cover coming off,

Conditions During Body Inspection: Wet

**Under Carriage & Under Bonnet Inspection Comments**

Front wheel drive, Drive belt noisy, Battery insecure, Large oil leak from front crank seal  
LVV Cert for rear seats #2161KK

**Interior Comments**

Seats	Average
Carpets	Average
Panels	Average
Dashboard	Average

**General Comments**

Front seats badly stained, Drivers seat loose on rails, Glovebox won't open, Rear washer not working, Front & rear wipers need replacing, Rear roof lining coming down, Vehicle pulls left

Road Conditions During Test Drive: Dry

Engine Timing Mechanism: Timing Chain  
Evidence of Cam Belt Replacement: Not Applicable Kms:

	Pass	Fail	N/A
<b>Engine</b>			
Oil level	✓		
Smoke & fumes	✓		
Performance	✓		
Noise	✓		
<b>Cooling System</b>			
Coolant condition	✓		
Performance	✓		
Radiator / Hoses (visual)	✓		
<b>Transmission</b>			
Operation	✓		
Noise	✓		
Clutch			✓
CV joints	✓		
Wheel bearings	✓		
<b>Brakes</b>			
Performance	✓		
Hand Brake	✓		
<b>Tyres</b> (lowest observed tread depth of tyres)			
Left front	8	mm	
Right front	7	mm	
Left rear	8	mm	
Right rear	6	mm	
Spare	Yes		
<b>Suspension</b>			
Suspension performance	✓		
Steering performance	✓		
Shock absorbers	✓		
<b>Air Conditioning / Heater</b>			
Operation	✓		
<b>Electrical / Accessories</b>			
Head lights	✓		
Tail lights	✓		
Indicators	✓		
Dashboard warning lights	✓		
Wipers (front & rear)		✓	
Window winder FL	✓		
Window winder FR	✓		
Window winder RL			✓
Window winder RR			✓
Rear view mirrors	✓		
Radio (basic test only)	✓		
CD (basic test only)	✓		
Number of keys	1		
Central locking	✓		
Remote locking	✓		
Sat. Nav. (basic test only)			✓
Reversing camera			✓

Inspected by: Andre Richardson

Date: 12 Dec 2024

I have read and understood this condition guide. Name: ..... Signature: .....