

Basic Vehicle Condition Guide

Report ID: 26,501,837


Version:

Created: 09 Jan 2025

Make: Model: Foton Tunland **Body Style:** Utility Year: 2016 Registration: JZF423 Reg Expiry: 31 Aug 2025 **WoF Expiry: Odometer:** 16 May 2025 101,977 Kms **Good No:** 26501837 VIN: LVAV2MBB1GJ040721 Next Service: 110,000kms **Service History:**

Note: This report is not a warranty

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

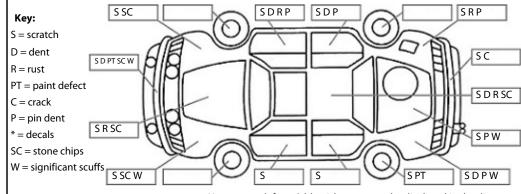

Body Inspection Comments

Note: some defects & blemishes may not be displayed in the diagram

Left front spot light lens has cracks in it. Metal support bar for rear deck tonneau cover is missing. Inside edge worn out on spare tyre.

Conditions During Body Inspection: Dry

Under Carriage & Under Bonnet Inspection Comments

Oil weeping from around right rear corner of engine sump pan & from between engine/ gearbox area.

Interior Comments	
Seats	Average
Carpets	Good
Panels	Average
Dashboard	Good

General Comments

Hole worn in base pad of driver's seat. Rubber buttons worn off key remote, remote still works fine. Right front radio speaker is not working. Centre console lid has a crack in it.

Road Conditions During Test Drive: Dry

Engine Timing Mechanism: Timing Chain

Evidence of Cam Belt Replacement: Not Applicable Kms:

Inspected by: Jason Young Date: 08 Jan 2025

	Pass	Fail	N/A		
Engine					
Oil level	~				
Smoke & fumes	~				
Performance	~				
Noise		~			
Cooling System					
Coolant condition	~				
Performance	V				
Radiator / Hoses (visual)	~				
Transmission					
Operation	~				
Noise	~				
Clutch	~				
CV joints	\(\times \)				
Wheel bearings	~				
Brakes					
Performance	~				
Hand Brake	~				
Tyres (lowest observed tread depth of tyres)					
Left front	1.6		mm		
Right front	4.6		mm		
Left rear	4.8		mm		
Right rear	4.6		mm		
Spare		Yes			
Suspension					
Suspension performance	~				
Steering performance	~				
Shock absorbers	~				
Air Conditioning / Heater					
Operation	~				
Electrical / Accessories	•				
Head lights	~				
Tail lights	~				
Indicators	~				
Dashboard warning lights	~				
Wipers (front & rear)	~				
Window winder FL	~				
Window winder FR	~				
Window winder RL	V V V V V				
Window winder RR	~				
Rear view mirrors	~				
Radio (basic test only)	~				
CD (basic test only)	~				
Number of keys	1		•		
Central locking	~				
Remote locking	~				
Sat. Nav. (basic test only)			~		
Reversing camera			~		

I have read and understood this condition guide.

Name:

Signature: