


| | | |
|--------------------------------|---------------------------------|--------------------------------|
| Make: Toyota | Model: Corona | Body Style: Sedan |
| Year: 1998 | Registration: BEA103 | Reg Expiry: 02 Sep 2025 |
| WoF Expiry: 10 Feb 2025 | Odometer: 237,198 Kms | Good No: 26508984 |
| VIN: 7A8H6050702012434 | Next Service: 226,000kms | Service History: No |

Note: This report is not a warranty

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

Key:

- S = scratch
- D = dent
- R = rust
- PT = paint defect
- C = crack
- P = pin dent
- * = decals
- SC = stone chips
- W = significant scuffs

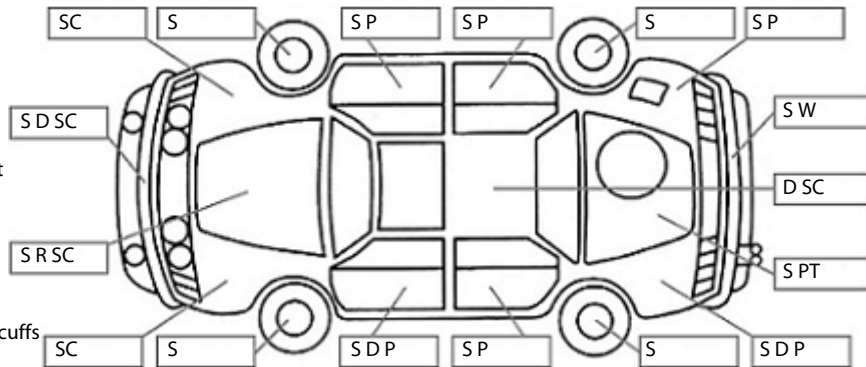

Body Inspection Comments

Note: some defects & blemishes may not be displayed in the diagram

Both front headlights are not working on low beam. Cracks & water inside both left rear taillight lenses. Two small stone cracks in left side of windscreen. Left rear tyre needs replaced & outside edge on worn very low, also needs replaced.

Conditions During Body Inspection: **Wet**

Under Carriage & Under Bonnet Inspection Comments

Oil weeping from around engine/gearbox area, oil weeping from around cam belt cover area on right side of engine block. Grease weeping out of right front inner cv boot. Rear diff is weeping oil.

Interior Comments

| | |
|-----------|---------|
| Seats | Good |
| Carpets | Average |
| Panels | Good |
| Dashboard | Good |

General Comments

Engine is a bit noisy. Engine is overdue service. Radio is not picking up any radio stations. Seal damaged on right front door. Carpet is worn in right front foot well area. Vibration coming through steering column when turning wheel. Writing worn off cam belt label in engine bay.

Road Conditions During Test Drive: **Wet**

Engine Timing Mechanism: **Cambelt**
 Evidence of Cam Belt Replacement: **No** Kms:

| | Pass | Fail | N/A |
|---|------|------|-----|
| Engine | | | |
| Oil level | ✓ | | |
| Smoke & fumes | ✓ | | |
| Performance | ✓ | | |
| Noise | | ✓ | |
| Cooling System | | | |
| Coolant condition | ✓ | | |
| Performance | ✓ | | |
| Radiator / Hoses (visual) | ✓ | | |
| Transmission | | | |
| Operation | ✓ | | |
| Noise | ✓ | | |
| Clutch | ✓ | | |
| CV joints | ✓ | | |
| Wheel bearings | ✓ | | |
| Brakes | | | |
| Performance | ✓ | | |
| Hand Brake | ✓ | | |
| Tyres (lowest observed tread depth of tyres) | | | |
| Left front | 5.3 | mm | |
| Right front | 4.0 | mm | |
| Left rear | 0.5 | mm | |
| Right rear | 2.5 | mm | |
| Spare | Yes | | |
| Suspension | | | |
| Suspension performance | ✓ | | |
| Steering performance | ✓ | | |
| Shock absorbers | ✓ | | |
| Air Conditioning / Heater | | | |
| Operation | ✓ | | |
| Electrical / Accessories | | | |
| Head lights | | ✓ | |
| Tail lights | | ✓ | |
| Indicators | ✓ | | |
| Dashboard warning lights | ✓ | | |
| Wipers (front & rear) | ✓ | | |
| Window winder FL | ✓ | | |
| Window winder FR | ✓ | | |
| Window winder RL | ✓ | | |
| Window winder RR | ✓ | | |
| Rear view mirrors | ✓ | | |
| Radio (basic test only) | | ✓ | |
| CD (basic test only) | ✓ | | |
| Number of keys | 2 | | |
| Central locking | ✓ | | |
| Remote locking | ✓ | | |
| Sat. Nav. (basic test only) | | | ✓ |
| Reversing camera | | | ✓ |

Inspected by: Jason Young

Date: 03 Jan 2025

I have read and understood this condition guide. Name: Signature: